



# Service Bulletin

Bulletin No.: PIT6496A

Date: March, 2026

## PRELIMINARY INFORMATION

**Subject: Service Headlight Message With DTC's B1B5F sym49 or B1B60 sym49 set in History**

| Brand:   | Model:       | Model Year: |    | VIN:                |         | Engine: | Transmission: |
|----------|--------------|-------------|----|---------------------|---------|---------|---------------|
|          |              | from        | to | from                | to      |         |               |
| Cadillac | Escalade     | 2026        |    | November 12th, 2025 | Current | All     | All           |
| Cadillac | Escalade ESV | 2026        |    | November 12th, 2025 | Current | All     | All           |

|                            |                                                                                                                                                |
|----------------------------|------------------------------------------------------------------------------------------------------------------------------------------------|
| Involved Region or Country | North America, MEO, Korea, Japan                                                                                                               |
| Condition                  | Some customers may comment of a "Service Headlamp" message. When checking for DTC's there will be history DTCs B1B5F sym49 and/or B1B60 sym49. |
| Cause                      | GM Engineering is investigating.                                                                                                               |

### Correction

Perform the following diagnostic steps:

If the DTCs B1B5F sym49 or B1B60 sym49 are current:

- Follow SI diagnostics as required.

If the DTC's B1B5F sym49 or B1B60 sym49 are history:

- Clear history DTCs.
- Verify that the headlights and auto level function of the headlamp is functioning when the vehicle is started. Do this by covering the ambient light sensor on the dash and visually confirming the vertical (up/down) movement of the headlamp beam pattern and/or interior lenses.
- Verify that the "service headlamp" message does not appear and no DTCs are set.
- If the headlights are operating properly with no messages and no DTCs B1B5F sym49 or B1B60 sym49 then return the vehicle to the customer, if not then follow normal SI diagnostics as necessary.

GM Engineering is investigating the source of this message/DTCs B1B5F sym49 or B1B60 sym49 and in the meantime please continue to drive your vehicle.

This PI will be updated or replaced with TSB once a determination has been made.

DO NOT replace headlamp assemblies for history DTCs B1B5F sym49 or B1B60 sym49.

**Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation                                          | Description                                      | Labor Time |
|----------------------------------------------------------|--------------------------------------------------|------------|
| 2081488*                                                 | Clear DTCs and verify proper headlight operation | 0.3 Hrs.   |
| *This is a unique Labor Operation for Bulletin use only. |                                                  |            |

|          |                                                                                         |
|----------|-----------------------------------------------------------------------------------------|
| Version  | 2                                                                                       |
| Modified | 03/17/2026 - Created on<br>03/19/2026 - Update to the Condition and correction sections |

