

## Technical product information

|                        |                                                                                                               |
|------------------------|---------------------------------------------------------------------------------------------------------------|
| <b>Topic</b>           | DTC B101629 and/or B12F129 and/or B151329 evident with 0015 (Airbag) with Airbag Indicator Lamp - Illuminated |
| <b>Market area</b>     | Bentley: worldwide (2WBE),China 796 VW Import Comp. Ltd (Vico), Beijing (6796)                                |
| <b>Brand</b>           | Bentley                                                                                                       |
| <b>Transaction No.</b> | 2080902/2                                                                                                     |
| <b>Level</b>           | EH                                                                                                            |
| <b>Status</b>          | Released for publishing                                                                                       |
| <b>Release date</b>    | March 27 2026                                                                                                 |

### Event memory entries

| <b>Diagnostic address</b> | <b>Event memory entry</b>                                                            | <b>Fault type</b> | <b>Fault status</b> |
|---------------------------|--------------------------------------------------------------------------------------|-------------------|---------------------|
| 0015 - Airbag             | B12F129: Front passenger airbag -enabled- indicator lamp implausible signal          |                   | Intermittent        |
| 0015 - Airbag             | B12F129: Front passenger airbag -enabled- indicator lamp implausible signal          |                   | static              |
| 0015 - Airbag             | B151329: Front passenger airbag indicator lamp, text illumination implausible signal |                   | static              |
| 0015 - Airbag             | B101629: Front passenger airbag -disabled- indicator lamp implausible signal         |                   | Intermittent        |
| 0015 - Airbag             | B101629: Front passenger airbag -disabled- indicator lamp implausible signal         |                   | static              |
| 0015 - Airbag             | B151329: Front passenger airbag indicator lamp, text illumination implausible signal |                   | Intermittent        |

### New customer code

| <b>Object of complaint</b>                                                                                            | <b>Complaint type</b>      | <b>Position</b> |
|-----------------------------------------------------------------------------------------------------------------------|----------------------------|-----------------|
| information, navigation, communication, entertainment -> symbolic warning indicators -> airbag system warning display | functionality -> activates |                 |

# Vehicle data

## Continental GT/GTC

### Sales types

| Type | MY   | Brand | Designation | Engine code | Gearbox code | Final drive code |
|------|------|-------|-------------|-------------|--------------|------------------|
| 3S3* | 2018 | E     |             | *           | *            | *                |
| 3S3* | 2019 | E     |             | *           | *            | *                |
| 3S3* | 2020 | E     |             | *           | *            | *                |
| 3S3* | 2021 | E     |             | *           | *            | *                |
| 3S3* | 2022 | E     |             | *           | *            | *                |
| 3S3* | 2023 | E     |             | *           | *            | *                |
| 3S3* | 2024 | E     |             | *           | *            | *                |
| 3S4* | 2019 | E     |             | *           | *            | *                |
| 3S4* | 2020 | E     |             | *           | *            | *                |
| 3S4* | 2021 | E     |             | *           | *            | *                |
| 3S4* | 2022 | E     |             | *           | *            | *                |
| 3S4* | 2023 | E     |             | *           | *            | *                |
| 3S4* | 2024 | E     |             | *           | *            | *                |

## Flying Spur

### Sales types

| Type | MY   | Brand | Designation | Engine code | Gearbox code | Final drive code |
|------|------|-------|-------------|-------------|--------------|------------------|
| ZG2* | 2020 | E     |             | *           | *            | *                |
| ZG2* | 2021 | E     |             | *           | *            | *                |
| ZG2* | 2022 | E     |             | *           | *            | *                |
| ZG2* | 2023 | E     |             | *           | *            | *                |
| ZG2* | 2024 | E     |             | *           | *            | *                |

# Documents

| Document name              |
|----------------------------|
| <a href="#">master.xml</a> |

## Technical product information

Transaction No.:  
**2080902/2**

DTC B101629 and/or B12F129 and/or B151329 evident with 0015 (Airbag) with  
Airbag Indicator Lamp - Illuminated

## Customer statement / workshop findings

### Customer Statement

The customer reports that the airbag warning lamp is illuminated in the instrument cluster and the front passenger airbag indicator lamp within the roof console does not function.



**Figure 1.** Airbag warning illuminated in the instrument cluster

### Workshop Findings

Customer findings of airbag warning lamp illuminated in the instrument cluster verified in the workshop with the following DTCs stored in the airbag control module (address word 0015):

- B101629: Front passenger airbag - disabled- indicator lamp implausible signal – symptom code 9442857
- B12F129: Front passenger airbag -enabled- indicator lamp implausible signal – Symptom code 9629993
- B151329: Front Passenger airbag indicator lamp, text illumination implausible signal – symptom code 9769769

## Technical background

An implausible signal from the passenger airbag indicator is being reported to the airbag control unit. This behaviour is consistent with a connection or fitment issue at the roof console indicator module. A connection check and module fit inspection is required. Refer to the *Measure* section for the approved service action.

## Revision History

2080902/2 – Revised TPI title to reflect applicable DTC codes.

## Production change

Not applicable

## Measure



### CAUTION

**Follow all ElsaPro airbag safety procedures. Incorrect handling can cause system faults or unintended deployment. Before disconnecting any connectors, switch off the ignition and allow control units to shut down.**

1. Inspect the roof console module and ensure the housing is fully clipped together.

Gaps or incomplete assembly may cause the indicator not to function.

2. Remove the front roof console module, check all electrical connectors at the roof console module.

Refer to ElsaPro → Rep. Gr. 70 'Front roof console - To remove and fit'

3. Confirm terminals are fully seated, check for bent, recessed or damaged pins

4. Disconnect and reconnect the roof console module.

5. Clear DTCs and recheck operation.

6. If the warning lamps clear and the system functions normally, no further action is required.



### NOTICE

**If faults persist or the indicator lamp remains inoperative, please raise a full technical DISS query and escalate it to second-level review by the Electrical TM for further guidance.**



**Include the following in the full technical DISS query:**

- VIN, model, MY
- Customer Statement: "2080902 Support"
- Symptom description.
- Complete diagnostic logs.

## Warranty accounting instructions

Warranty type 110 or 910

Damage service number 96 20

Damage code 00 40

### Labour

#### Time to remove and fit roof module

Labour Operation Code: 96 20 19 00

Time: 20 TU (Continental GT/GTC)

Time: 10 TU (Flying Spur)

#### GFF Guided Functions

Labour operation code 01 50 00 00

Time 10 TU

## Parts information

No parts are required for the initial repair procedure.

If further action is advised through a DISS response, part numbers and replacement guidance will be provided by Bentley Technical Support.