

Title: SSM 54673

2025-2026 Bronco - Badlands And Raptor Only - "Cruise Control Not Available" Message Displayed In The IPC With U0418:86 Stored In The IPMA

Text:

Some 2025-2026 Bronco Badlands and Raptor only vehicles may exhibit a "Cruise Control Not Available" or "Active Cruise Control Not Available" message displayed in the instrument panel cluster (IPC) with diagnostic trouble code (DTC) U0418:86 stored in the image processing module A (IPMA) and no DTCs present in the anti-lock brake (ABS) module. If a vehicle exhibits this condition, carefully inspect the rear wheel speed sensors for correct installation with the rear wheel speed sensor body seated flush against the axle housing. Repair as needed, clear the DTC, and retest. Refer to Workshop Manual (WSM), Section 206-09. The end of the sensor can also be inspected for contamination and service as needed and retest. If the condition persists, inform customers that they can continue to drive the vehicle and engineering is currently working on a solution for this condition that is expected in Q2 of 2026.