



Connection offline

Technical Service Bulletin

Transaction No.: **2070915/2**

01 loose engine oil filler cap - P006800, P227900, P050700 - 2.0 ltr. TFSI

Release date: Mar 10, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A4, A4 allroad, A5 Sportback, A6, Q5, and Q5 Sportback	2021 – 2025	All	2.0 ltr TFSI
A5, and A5 Cabriolet	2021 – 2024		
A3, and S3	2022 – 2024		
Q7	2023 - 2025		

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Condition</i> (Added fault to workshop findings, added photos) Revised Warranty (added a warranty table)
1	07/19/2023	Initial publication


Customer states:

- MIL on.
- The engine is running rough.
- There is oil on the engine near the oil filler cap.

Workshop findings:

The event memory of the engine control unit does not necessarily have to contain an entry, one or more of the following DTC entries may be logged:

- **P227900** – Intake Air System Leak.
- **P006800** – MAP/MAF, Throttle Position Correlation.
- **P004F00** – Fuel tank breather system, high-pressure faulty.

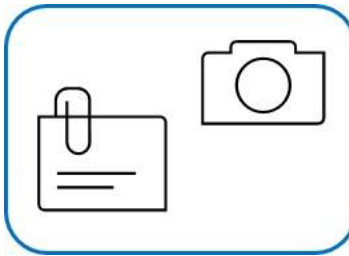

Documentation Required

Technical Background

Possibly caused by an incorrectly installed oil filler cap.



Figure 1. An incorrectly installed oil filler cap.



Figure 2. The image bordered in red is an incorrectly installed oil filler cap; a correctly installed oil filler cap is bordered in green.

When billing, please always attach photos/videos that clearly show the complaint to DOC-IT. To ensure a reference to the vehicle, the image/video must:

- Include the VIN and date.
- Must not be edited.
- Should be in focus and taken with sufficient light. A high resolution is not necessary.
- If appropriate, please mark the location of the problem so that parts analysis has a clear reference to the complaint. Please ensure that the photo documentation does not show any people and/or face, license plates,

or customer data.

Production Solution

Not applicable.

Service

Oil filler cap not closed correctly

Insert the oil filler cap in the correct position. Before inserting the cap, thoroughly clean the contact surfaces of the cap and filler neck.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	1714		
Damage Code:	0018		
Labor Operations:	GFF	0150 0000	Time stated on the diagnostic protocol
	Charge Battery	2706 8950	See SRT with associated operations
	Remove and install filler cap	1714 1950	See SRT with associated operations
Claim Comment:	As per TSB 2070915/2		

All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2070915**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.