



Connection offline

Technical Service Bulletin

Transaction No.: **2080825/2**

19 Cooling system: V188 blocked - P2BC100

Release date: Mar 10, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5, S5 (FU)	2025 – 2026	All	Engine code: DXBA
Q5, Q5 Sportback (GU)	2025 – 2026		Engine code : DXCA

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Updated verbiage)
1	01/30/2026	Initial publication

Customer states:

- The check engine light and/or the message “Drive system: fault. Limited performance. Please contact workshop” appear in the instrument cluster.

Workshop findings:

The following DTC is logged in the *Engine Control Module -J623-*, (address word 0001) regarding additional coolant pump V188:

- DTC P2BC100:** Coolant pump for charge air cooler, blocked

Technical Background

After extended stationary periods lasting for more than two months, additional coolant pump V188 may sometimes be blocked in rare cases.

Production Solution

Not applicable.

Service

This TSB only applies if the vehicle previously remained stationary for an extended period (>2 months).

If a blockage is indicated in the event memory entry, first perform an output diagnostic test and attempt to activate the pump. Listen for an audible running noise; when doing so, it may be necessary to loosen the front left wheel housing liner.

If the pump is running and the fault is only logged as intermittent in the event memory, delete the entry. In this case, it is not necessary to replace the pump.

If the pump is malfunctioning, it must be replaced.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	1947		
Damage Code:	0040		
Labor Operations:	If pump V188 is not replaced:		
	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Time stated on the diagnostic protocol
	Only if pump V188 is faulty and replaced:		
	Remove and install additional coolant pump V188, only if faulty	1947 19xx	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2080825/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

Additional Information

All part and service references provided in this TSB (**2080825**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.