

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5, S5 (FU), Q5, SQ5, Q5 Sportback, and SQ5 Sportback,	2025 – 2026	All	Not Applicable
A6 Sportback e-tron, S6 Sportback e-tron, Q6 e-tron, Q6 Sportback e-tron, SQ6 e-tron, and SQ6 Sportback e-tron	2025		
A6 (FN)	2026		

Customer states:

The customer complains that the driver assist systems and traffic sign recognition sometimes do not work properly.

The following symbols are some of the warnings which may be displayed:



Image 1: Front assist



Image 2: Distance warning



Image 3: Lane departure warning

 


Image 4: Traffic sign recognition

Workshop findings:

- The customer statements can be reproduced.
- The following event memory entries may be logged in diagnostic address 8103 or 00A5:
 - **U147C00**: Emergency call module and communication unit, implausible signal
 - **U194E00**: Ethernet application server 3 for system 1 infotainment, implausible signal
 - **U198C00**: Road graph error value received

Technical Background

Software issue relating to GPS signal.

Production Solution

New software introduced into production in week 06/2026.

Service

Proceed as follows if this issue occurs:

Please perform a terminal 30 reset at diagnostic address 0075 (emergency call module control unit and communication unit J949).

Refer to TSB 2077111, *91 Audi connect ConMod: New HCP cars having functional issues with connect services*

Then drive the vehicle outdoors for several minutes or leave it standing with the ignition on; reception must be good.

After this, please check the status of the emergency call LED in the roof module. The status should be permanently green when the ignition is switched on.

For some country-specific versions, a final software solution will be rolled out with the next KD software package (KD2*). Initial availability expected in second quarter of 2026.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9145		
Damage Code:	0039		
Labor Operations:	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
	Service telematics control unit	9170 4199	20 TU
Claim Comment:	As per TSB 2081403/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor, gearbox code, PR number(s), part number, software version, code, etc.) apply exactly. Otherwise, this solution will not eliminate the problem and repeat repairs may be necessary. In such a case, the warranty claim may be rejected, and the cost of the parts may be charged back.

Additional Information

All part and service references provided in this TSB (**2081403**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.