

TECHNICAL TOPICS

POWERTRAIN



PCM U0111-00 Lost Communication With Battery Energy Control Module "A" after update	19MY – Onward Range Rover, RR Sport MHEV
Technical Description: - Following a PCM/EPICD/BECM combination update, the PCM stores 12652800 (U0111-00) and the BECM appears offline. Status: - Carefully inspect the 48V battery cables and connector for proper fit, terminal tension at the connector and proper seating. Correct any issues identified before proceeding. - Start a new PATHFINDER session. - Use a wiring diagram to find the fuse supplying the BECM. - Remove the fuse. - Select the campaign again and start the update. - Re-fit the fuse about 20 seconds into the BECM update. - Allow a full bus sleep following completion of the update. - If the condition persists following a bus sleep, disconnect the 12V battery and allow the vehicle to sit for 10 minutes. Reconnect the battery and re-evaluate. - If diagnostic support is required after both steps have been completed, raise a TA.	

