



Preliminary Information

PIP5788A DTC P2635 Set

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500	2021	All	All	5.3 L82 L84 6.2 L87	All
GMC	Sierra 1500	2021	All	All	5.3 L82 L84 6.2 L87	All

Involved Region or Country	North America
Condition	Some customers may comment that the SES lamp is illuminated or was illuminated and turned off, with no drivability concerns. During inspection Technician may notice DTC P2635.
Cause	Unknown at this time

Correction:

If you encounter a vehicle with the above DTC, follow the applicable diagnostic flow chart in service information for further diagnosis and repair.

If the diagnostic does not isolate the concern, replace fuel feed pipe (fuel line between the high-pressure fuel pump and chassis line), clear the codes, and return it to the customer.

If the truck has already had the fuel jumper replaced, do not replace again. Follow diagnostic flow chart to ensure a different issue has not developed.

If it does not isolate the concern, clear codes only and return to the custom.

Engineering knows about the concern and is working on a more permanent service procedure.

This PI will be updated as information is gathered.

Version History

Version	1
Modified	03/16/2021 - Created on. 04/15/2021 - updated the correction statement

