



Preliminary Information

PIP5276G SES Lamp P0521 Setting After An Oil Change And Or Low Oil Pressure Indicated On The Instrument Panel

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CTS-V	2007 - 2013	All	All	LSA	All
Cadillac	Escalade	2007 - 2013	All	All	L94, LH9	All
Chevrolet	Avalanche	2007 - 2013	All	All	L20, LC9, LMG	All
Chevrolet	Camaro SS	2007 - 2013	All	All	L99	All
Chevrolet	Colorado	2007 - 2013	All	All	LH9	All
Chevrolet	Corvette	2007 - 2013	All	All	LS3, LS7, LS9	All
Chevrolet	Express	2007 - 2013	All	All	L20, LMF, LC8, L96	All
Chevrolet	Silverado	2007 - 2013	All	All	L20, L9H, LC9, LMG, LC8, LY6, L96	All
Chevrolet	Suburban	2007 - 2013	All	All	L94, LMG, L9H, LC9, L96	All
Chevrolet	Tahoe	2007 - 2013	All	All	L20, LC9, LMG	All
GMC	Canyon	2007 - 2013	All	All	LH9	All
GMC	Sierra	2007 - 2013	All	All	L20, L9H, LC9, LMG, LC8, LY6, L96	All
GMC	Yukon	2007 - 2013	All	All	L94, LMG, L9H, LC9, L96	All

Supersession Statement

This PI was superseded to update Recommendation/Instructions. Please discard PIP5276F.

Condition / Concern

Some customers may complain of a SES light or low oil pressure indicated on the instrument panel cluster with DTC P0521 stored. In some cases, this may have started shortly after an oil change.

Recommendations / Instructions

- If you are working on a Gen4 V8 that is setting a DTC P0521 and/or has low oil pressure indicated on the instrument panel in cold or hot weather and the engine is currently equipped with a PF48E or PF48 oil filter, determine if the engine has been properly repaired and cleaned following the procedure used in the latest version of bulletin 10-06-01-008.
- If not, please update the engine with the components outlined in the bulletin.
- If it has been properly repaired and cleaned, inspect the left rocker cover (square baffle) and verify that the baffles can hold water and do not leak.
- If any leaks are found, clean and seal the edge of the baffle with RTV if possible or replace the valve cover.
- Thoroughly clean and dry the valve cover before installation and/or resealing.
- Change the engine oil and replace the oil filter using a PF48E or PF48 type filter.

Parts Information

Refer to the electronic parts catalog and/or latest version of [10-06-01-008](#) for the appropriate part numbers.

Warranty Information

The correction for this concern may be one of several repairs described above. For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair.



© 2022 General Motors. All Rights Reserved.