

Technical Journal

TITLE:

“eCall Service Required” message, Back-up battery DTC TCAM-U210993REF NO:
TJ 35808.1.3ISSUING DEPARTMENT:
Technical ServiceCAR MARKET:
United States and CanadaPARTNER:
3 US 7510 Volvo Car USAISSUE DATE:
2022-05-06STATUS DATE:
2022-05-06FUNC GROUP:
3943FUNC DESC:
Telematics**Page 1 of 5****“Right first time in Time”**

Attachment

File Name	File Size
TJ35808BUB.jpg	0.1558 MB
TJ35808BUB RESET.jpg	0.2018 MB

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

*Added new labor op.

Vehicle types added

Alternative BUB charging method added

If there is a warning message in the DIM and CCD about “eCall service required” together with DTC TCAM-U210993 pointing out the BUB, please follow the procedure under “Service”.

DIM = Driver Information Module

CCD = Center Console Display

BUB = Backup Battery

TCAM = Telematic Connectivity Antenna Module

SOC = State Of Charge

Technical Journal 35808.1.3

CSC Customer Symptom Codes

Code	Description
6K	Mobile app Volvo Cars/Activation problems
6N	Mobile app Volvo Cars/Other communication problems
JG	Volvo On Call/Other Volvo On Call problems
KY	Volvo On Call/Does not work

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
235							2022-9999		-	202122-999952
236							2022-9999		-	202122-999952
238							2022-9999		-	202122-999952
246							2022-9999		-	202122-999952
536	ED	E400V6					2021-9999		-	202037-999952
539							2022-2022		-	202122-999952

SERVICE:

If the message together with the DTC is confirmed, the cause may be a discharged BUB.

Do not replace the BUB, first check if it is possible to charge it.

VIDA has been updated with a new method that allows charging of the BUB.

Begin by ensuring that the vehicle software is the latest (refer to TJ 31543)

VIDA charging method:

- A 12 volt battery maintainer must be connected to the vehicle throughout the BUB charging procedure.
- Gear selector must be in P - Park.
- If BUB SoC is 1% or greater, charge the BUB using the VIDA script, see attachment *TJ35602BUB*.
- BUB will charge by ~5% SOC per hour, charge the BUB up to minimum 45% SOC. (After charging is stopped the BUB SOC may drop slightly)
- If “*eCall Service Required*” is still shown in the DIM, then go to “SW Installation” tab in VIDA, click on “Advanced test” and click on “Reset”
- Once reset has completed, Erase DTCs.

If the DTC is set again then charge the BUB to above 50% SOC.

The BUB will then be continuously charged while the vehicle is driven.

NOTE:

If BUB SOC is 0% (below 2 Volt) it is not possible to charge the BUB and it needs to be replaced, see VIDA instruction VCC-516696-1.

After replacement the BUB SOC must be reset by using a VIDA script, see attachment *TJ35808BUB RESET.jpg*.

Information: A low or depleted 12v battery can cause the BuB to be discharged.

***Alternative method to charge the BuB using an external battery charger:**

- It is possible to charge the BuB outside the vehicle using a universal battery charger similar to ones used to charge radio-controlled device batteries. The charger should be suitable for a 1-cell lithium-ion (Li-ion) battery and supply 4V max and 1A, max. The charger should also have temperature control as the battery temperature must not exceed 60°C / 140°F during charging.

- To make an adapter harness to connect a charger to the BuB, the following parts are needed:

31450330 RECEPTACLE HOUSING (1x)

30656678 REPAIR TERMINAL (2x)

Connect the terminals as follows:

Pin 1 - Positive

Pin 4 - Negative

Warranty claim info:

To get warranty claim accepted for a job described in this TJ, please use following data:

VST OP number: 36050-2, 39753-2.

VST Operation Number

VST Operation Number	Description
09805	Recharging Backup Battery acc. to TJ 35808

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 3943.

To view TJ attachments continue to next page. This TJ has two attachments.

Technical Journal 35808.1.3



VIN: YV1XZEDVEM2494206

Customer Name:

Model/Year/Cha...: XC40, 2021, 494206

Lists

Planning

Customer Symptom Codes

Claim Types 

Technical Journals

Service Programs

Operations and Packages

Parts

Software

Diagnostics

Network

Fault Tracing

Components

Service Functions 

Documents

Diagnostic Sequences

Diagnostic Sequences



12 V power overview



Activate the telematics function in VCM



Battery diagnostic information



Calibration of Forward Looking Camera (FLC2)



Calibration of Forward Looking Radar (FLR)



Charging the TCAM backup battery 



Clear Stand Still Manager from Factory Mode



High voltage system, overview



Infotainment Head Unit (IHU) private locking pin code reset



Normal mode and vehicle speed limitation



Parking brake service position



Program the service conditions in the Driver Information Module (DIM)



Read-out distance, time and engine time since last service

TJ-35808

Technical Journal 35808.1.3



VIN: YV1XZEDVEM2494206
Model/Year/Cha...: XC40, 2021, 494206

Customer Name:

Lists

Planning

Customer Symptom Codes

Claim Types

Technical Journals

Service Programs

Operations and Packages

Parts

Software

Diagnostics

Network

Fault Tracing

Components

Service Functions

Documents

Diagnostic Sequences

Diagnostic Sequences

Battery diagnostic information

Calibration of Forward Looking Camera (FLC2)

Calibration of Forward Looking Radar (FLR)

Charging the TCAM backup battery

Clear Stand Still Manager from Factory Mode

High voltage system, overview

Infotainment Head Unit (IHU) private locking pin code reset

Normal mode and vehicle speed limitation

Parking brake service position

Program the service conditions in the Driver Information Module (DIM)

Read-out distance, time and engine time since last service

Read-out of the service conditions

Reset DTCs in Steering Column Lock (SCL)

Reset iTPMS calibration data and relevant DTCs

Reset the Infotainment Head Unit (IHU) to factory settings

Reset the service reminder indicator (SRI)

Resetting of long term wheel angle compensation

Resetting software after TCAM backup battery change

1

2

TJ-35808