



Service Bulletin

Bulletin No.: 21-NA-246

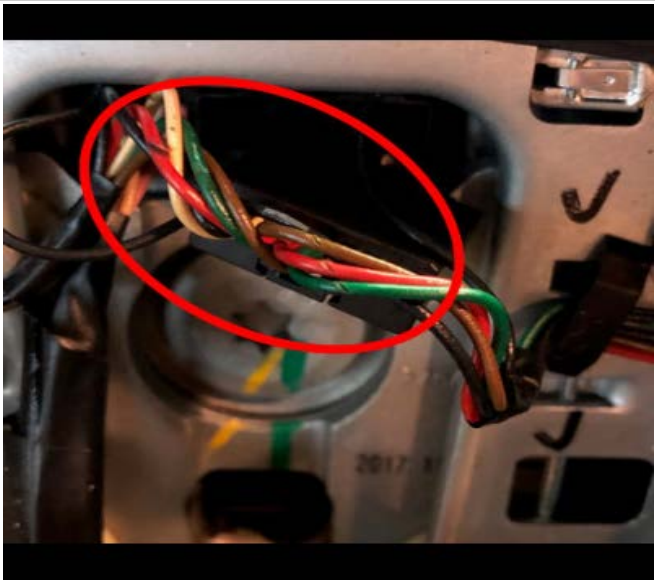
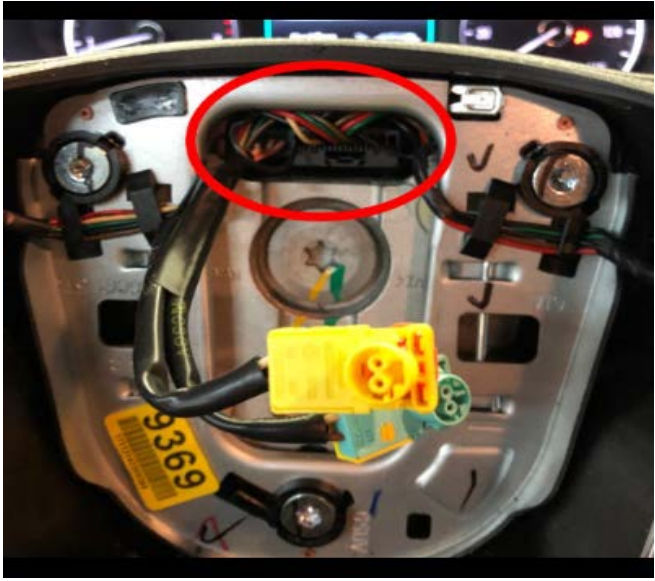
Date: January, 2022

TECHNICAL

Subject: Unwanted Front Windshield Wiper Swipe, Cruise Control Will Not Turn On, Steering Wheel Controls Inoperative, DTCs P155A/00, B1529/03

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2019	2020	—	—	All	All
Chevrolet	Trax						

Involved Region or Country	North America
Condition	Some customers may comment on one or more of the following conditions: " Unwanted front windshield swipe upon starting or powering up the vehicle. " Front wipers will not park. " Steering wheel controls inoperative or erratic operation. " Upon a vehicle scan check, DTCs P155A/00, B1529/03 might be stored current or in history.

Cause	 5480325  5480327 The cause of the condition may be the steering wheel harness shorted under the steering wheel inflator module.
Correction	If you encounter a vehicle with the above concern, inspect and repair the steering wheel harness referring to the proper wire repair procedures. Refer to Wire to Wire Repair in SI.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7486098*	Steering Wheel Harness Repair	0.6 hr
*This is a unique Labor Operation for bulletin use only.		

Version	2
Modified	Released November 03, 2021 January 19, 2022 – Changed DTC P1529 to B1529.

