

SSM 50861 - 2015-2016 Various Vehicles - 6F50/6F55 Transmission - No Reverse/3rd/5th Gear -Various DTCs - Built On 2-Nov-2015 And Through 1-Feb-2016 - New Service Part

Some 2015-2016 vehicles equipped with 6F50/6F55 transmission and built on 2-Nov-2015 and through 1-Feb-2016 may exhibit no reverse, 3rd and 5th gear with diagnostic trouble codes (DTCs) P0715,P0717,P0756 and/or P2701. This may be caused by the direct clutch cylinder/tone wheel (7F283) inadvertently forcing the snap ring out of position resulting in damage to the direct clutch hub (7G384). Service part (7J250) complete rotating 3-5-R clutch module is now available. Refer to Workshop Manual (WSM), Section 307-01. For claiming, use causal part 7F283 and applicable labor operations in Section 7 of the Service Labor Time Standards (SLTS) manual.

APPLICABLE VEHICLES

2015 - 2016 CAR: ED CD539A EDGE
2015 - 2016 CAR: DQ CD539N EDGE
2015 - 2016 CAR: DQ CD539N EDGE
2015 - 2016 CAR: PC D568C TAURUS
2015 - 2016 TRUCK: UB U502N EXPLORER
2015 - 2016 TRUCK: UB U502N EXPLORER
2015 - 2016 TRUCK: WJ U502E EXPLORER
2015 - 2016 TRUCK: WJ U502E EXPLORER
2015 - 2016 TRUCK: P3 D471N FLEX
2015 - 2016 TRUCK: P3 D471N FLEX
2015 TRUCK: Q1 U387/388N EDGE/MKX
2015 - 2016 CAR: LE D385N MKS
2015 - 2016 CAR: LE D385N MKS
2015 - 2016 TRUCK: P4 D472N MKT
2015 - 2016 TRUCK: P4 D472N MKT
2015 - 2016 CAR: C9 CD533N MKZ
2015 - 2016 CAR: PH D258N TAURUS
2015 - 2016 CAR: PH D258N TAURUS
2015 - 2016 TRUCK: UM U502S EXPLORER
2016 CAR: D9 U540N MKX
2016 CAR: D9 U540N MKX