



Service Bulletin

Bulletin No.: 22-NA-019

Date: September, 2022

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated with DTC P2251 and/or DTC P2254 Set

Brand:	Model:	Model Year:		Breakpoint Date:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CT5	2022	2022	SOP	June 9, 2022	3.6L Twin-Turbo (RPO LF4) 3.0L Twin-Turbo (RPO LGY)	—
Chevrolet	Corvette	2020	2021	—	—	6.2L (RPO LT2)	—
		2022	2022	SOP	November 16, 2021		

Involved Region or Country	North America, Europe, Middle East, Israel, Palestine, Japan, Thailand, Australia/New Zealand
Condition	Some customers may comment on a MIL illuminated in the driver information center (DIC). Technicians may find DTC P2251 (Heated Oxygen Sensor Low Reference Circuit Bank 1) and/or DTC P2254 (Heated Oxygen Sensor Low Reference Circuit Bank 2) is set current or in recent history.
Cause	The cause of the condition may be a software anomaly in the engine control module (ECM).
Correction	Reprogram the ECM. Note: Confirm there are no aftermarket exhaust manifold, catalytic converters, or mufflers that could affect the O2 sensors performance. The exhaust system should be returned to its original components (exhaust manifolds, catalytic converters and muffler) before attempting the programming the vehicle.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Caution: Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

- " Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- " Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to www.gmdesolutions.com for further information. If not available, connect a fully charged 12V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- " Follow the on-screen prompts regarding ignition power mode, but ensure that anything that drains excessive power (exterior lights, HVAC blower motor, etc) is off.

- " Please verify that the radio time and date are set correctly before inserting USB drive into vehicle for programming, otherwise an error will result.
- " Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.


Important: The service technician always needs to verify that the VIN displayed in the TLC left side drop down menu and the top center window match the VIN plate of the vehicle to be programmed prior to using Service Programming System 2 (SPS2) for programming or reprogramming a module.

- " For the TLC application, service technicians need to always ensure that the power mode (ignition) is "ON" before reading the VIN from the vehicle's VIN master module and that they do not select a VIN that is already in the TLC application memory from a previous vehicle.
- " If the VIN that shows up in the TLC top center window after correctly reading the VIN from the vehicle does not match the VIN plate of the vehicle, manually type in the VIN characters from


the vehicle VIN plate into the TLC top center window and use these for programming or reprogramming the subject module with the correct vehicle VIN and software and/or calibrations.

- " The Engine Control Module (ECM) is the master module (for VIP vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the ECM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.
- " The Body Control Module (BCM) is the master module (for GEM vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the BCM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.


Caution: Be sure the VIN selected in the drop down menu (1) is the same as the vehicle connected (2) before beginning programming.

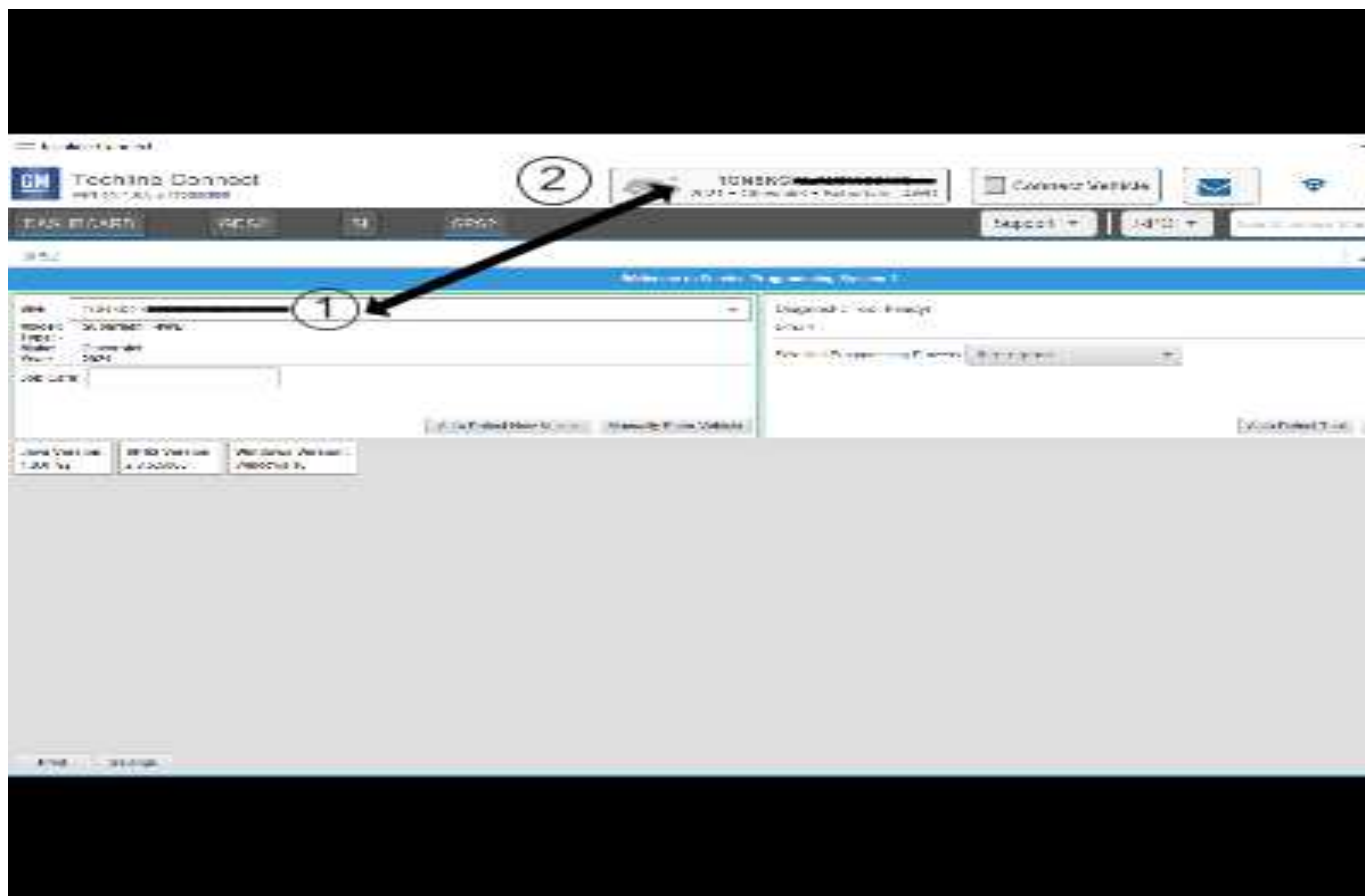

Important: If the vehicle VIN DOES NOT match, the message below will be shown.

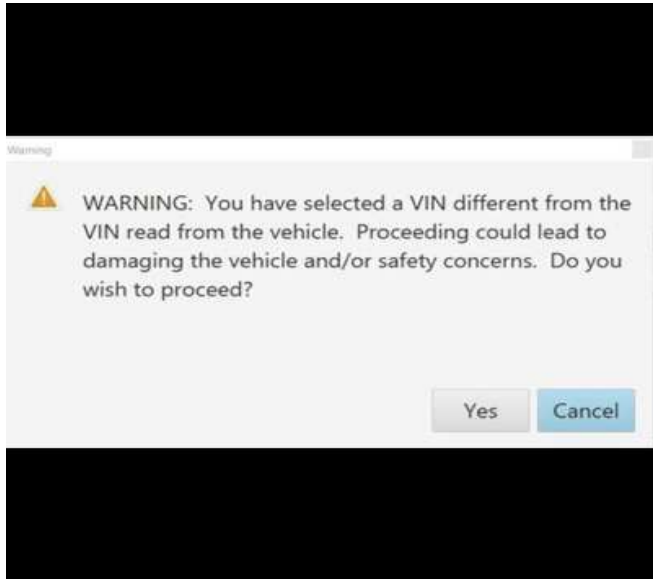

5877000

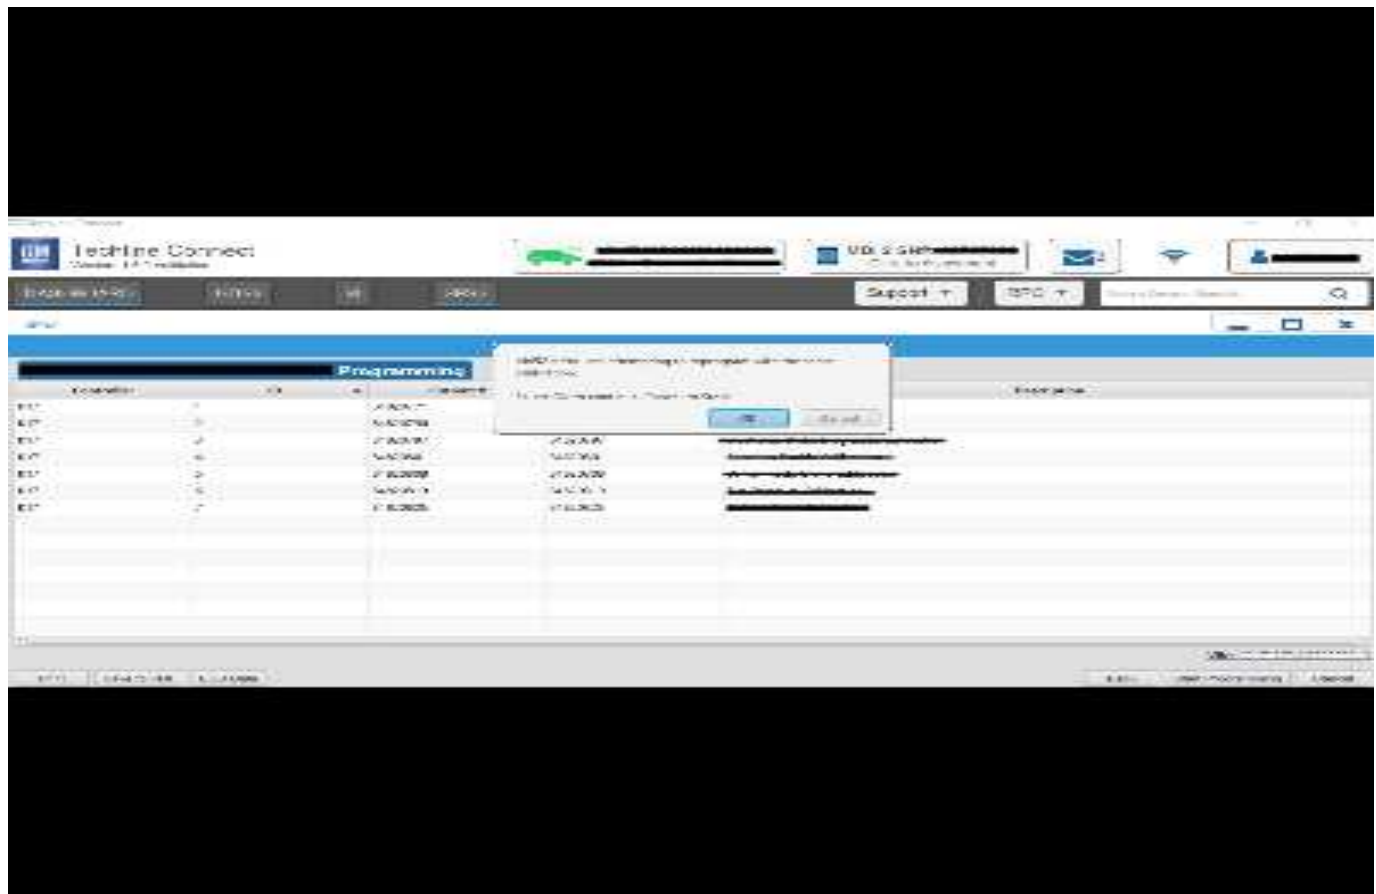


564477

Important: Techline Connect screen shown above.

Important: If the same calibration/software warning is noted on the TLC or SPS Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS

Summary screen. Record the WCC on the job card. No further action is required. Refer to the Warranty Information section of this bulletin.

1. Reprogram the Engine Control Module. Refer to K20 Engine Control Module: Programming and Setup in the Service Manual.

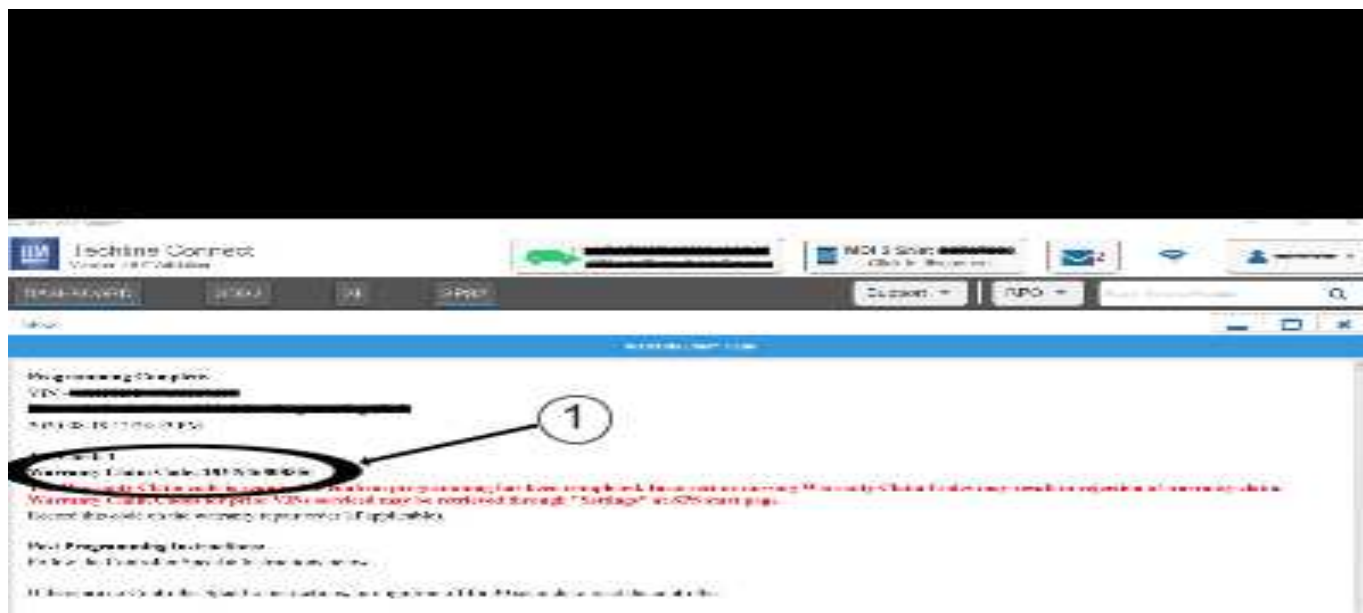


- Record the Warranty Claim Code on the job card for warranty transaction submission.

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information:

Labor Operation	Description	Labor Time
2888408*	Engine Control Module Reprogramming with SPS for software anomalies	0.3 hr
*This is a unique Labor Operation for bulletin use only.		
Important: To avoid warranty transaction rejections, carefully read and follow the instructions below: " The Warranty Claim Code must be accurately entered in the "SPS Warranty Claim Code" field of the transaction. " When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "SPS Warranty Claim Code" field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS/SPS2.		

Warranty Claim Code Information Retrieval

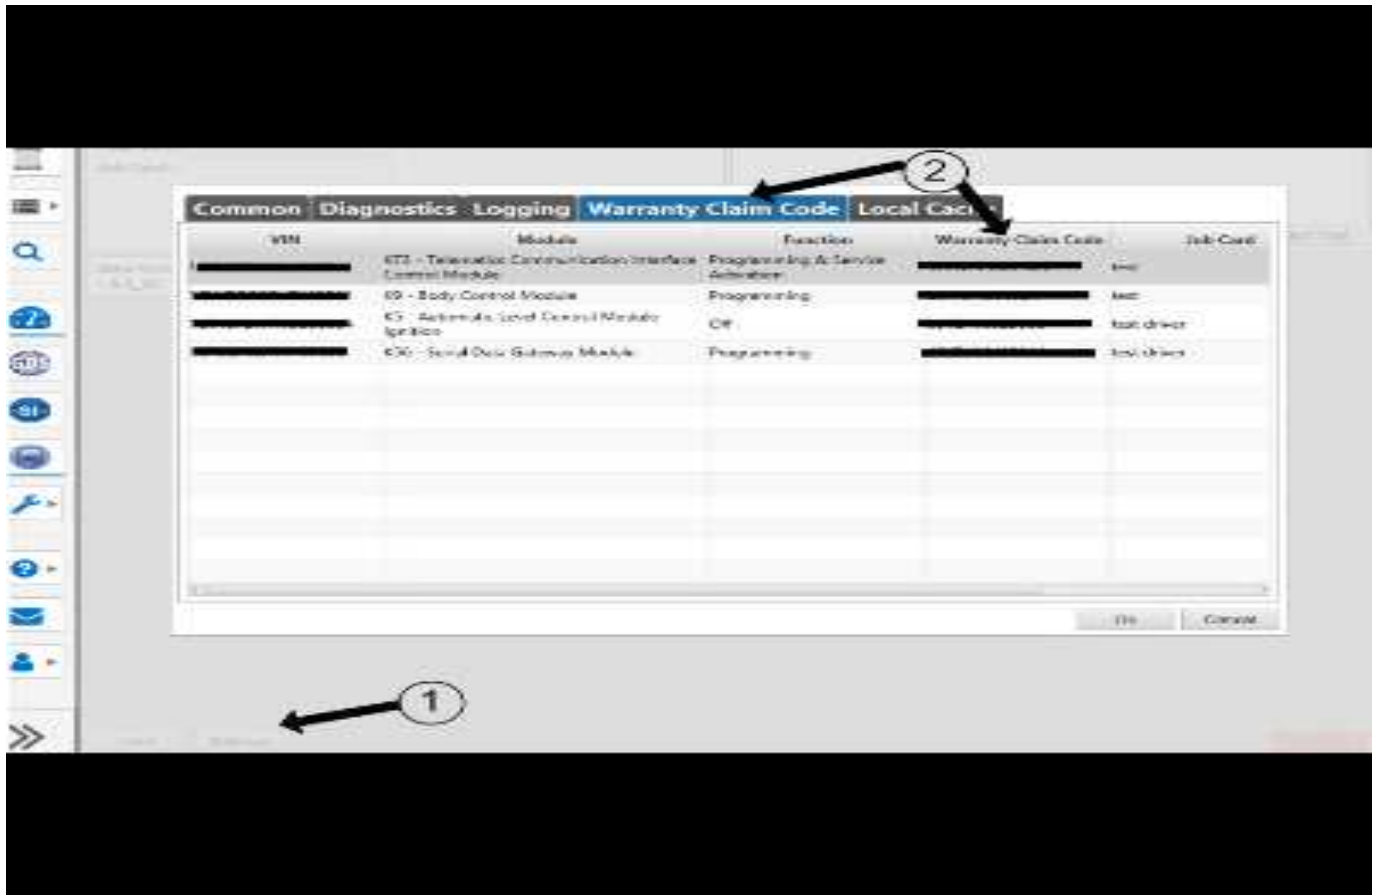

6125774

If the Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS2 system as follows:

1. Open TLC on the computer used to program the vehicle.
2. Select and start SPS2.
3. Select Settings (1).
4. Select the Warranty Claim Code tab (2).

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Version	4
Modified	Released January 27, 2022 Revised February 17, 2022 – Added the 2020 Model Year. Revised April 21, 2022 – Added the 2021 Model Year and updated the Involved Region or Country section. Revised September 16, 2022 – Added the 2022 Cadillac CT5 and updated the programming procedure.