

Technical Service Bulletin



37 Transmission warning message in cluster (DTC P060A00)

37 13 78 2031675/1 January 8, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2013	All	8 Speed transmission 0BK
S8			

Condition

Customer Complaint:

Transmission warning message in cluster.

Workshop Findings:

- **DTC P060A00** (Control module internal processor monitoring) stored in the TCM.
- No other concerns noted with vehicle.

Technical Background

The entry **P060A00** with **DFCC 12480** can be logged in the TCM. This fault is only a diagnostic error. The fault will not affect vehicle performance.

The DFCC is the 4-6 digit code that is typically listed before the fault (Figure 1).

12480	P060A00	[32]
Control module internal processor monitoring		
Sporadic		
Ambient requirements:		
Standard values:		
Date	18.12.2012	
Time	16:26:08	
km-Mileage	52 km	
Param_DTCPrior	2	
Occurrence Counter	1	
Central-Aging-Counter	255	

Figure 1. 4-6 digit DFCC code

Technical Service Bulletin



Production Solution

Not applicable.

Service

If the above DTC is stored in the TCM along with the DFCC according to this TSB, delete the above entry of the gearbox control unit and explain to the customer the technical background.

1. Do not perform any repairs. Any repairs for this concern may be denied.
2. Instruct the customer that this condition is known, and a solution is under development.

If different DFCCs are present, this TSB does not apply.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3730		
Damage Code:	0039		
Diagnostic Time:	GFF includes checking and clearing fault.	0150 0000	Time stated on diagnostic protocol (Max 40 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer' s discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2031675/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.