



Service Bulletin

Bulletin No.: 20-NA-130

Date: January, 2023


INFORMATION

Subject: Information on Message Illuminated in DIC, DTC B094C (39) Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Bolt EV	2019	2020	—	—	All	All


Involved Region or Country	North America, Europe, Middle East, GM Korea Company
Condition	Some customers may comment on a message illuminated in the driver information center (DIC). A technician may find DTC B094C (39) - Right Side Driver Assistance Systems set.
Cause	Note: Check the LED operation to try and help isolate the Condition to the driver or passenger mirror. The cause of the condition may be corrosion in the LED wiring harness connection in the left or right outside rearview mirror.
Correction	Upon verifying the condition, follow the appropriate direction and steps in the Service Procedure below.

Service Procedure

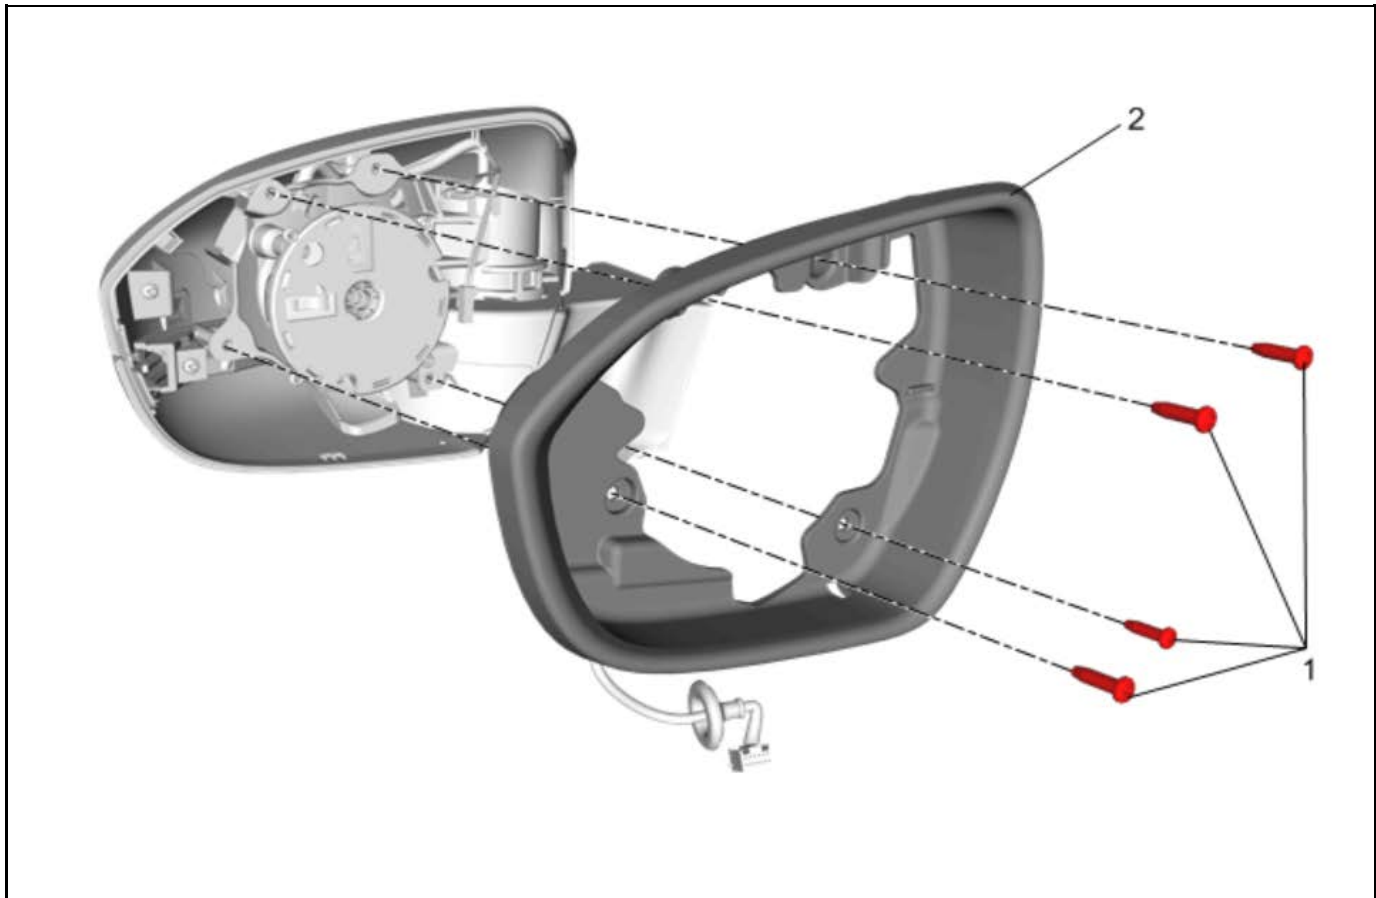

4533897

1. Remove the affected outside rearview mirror housing bezel (2). Refer to Outside Rearview Mirror Housing Bezel Replacement in SI.

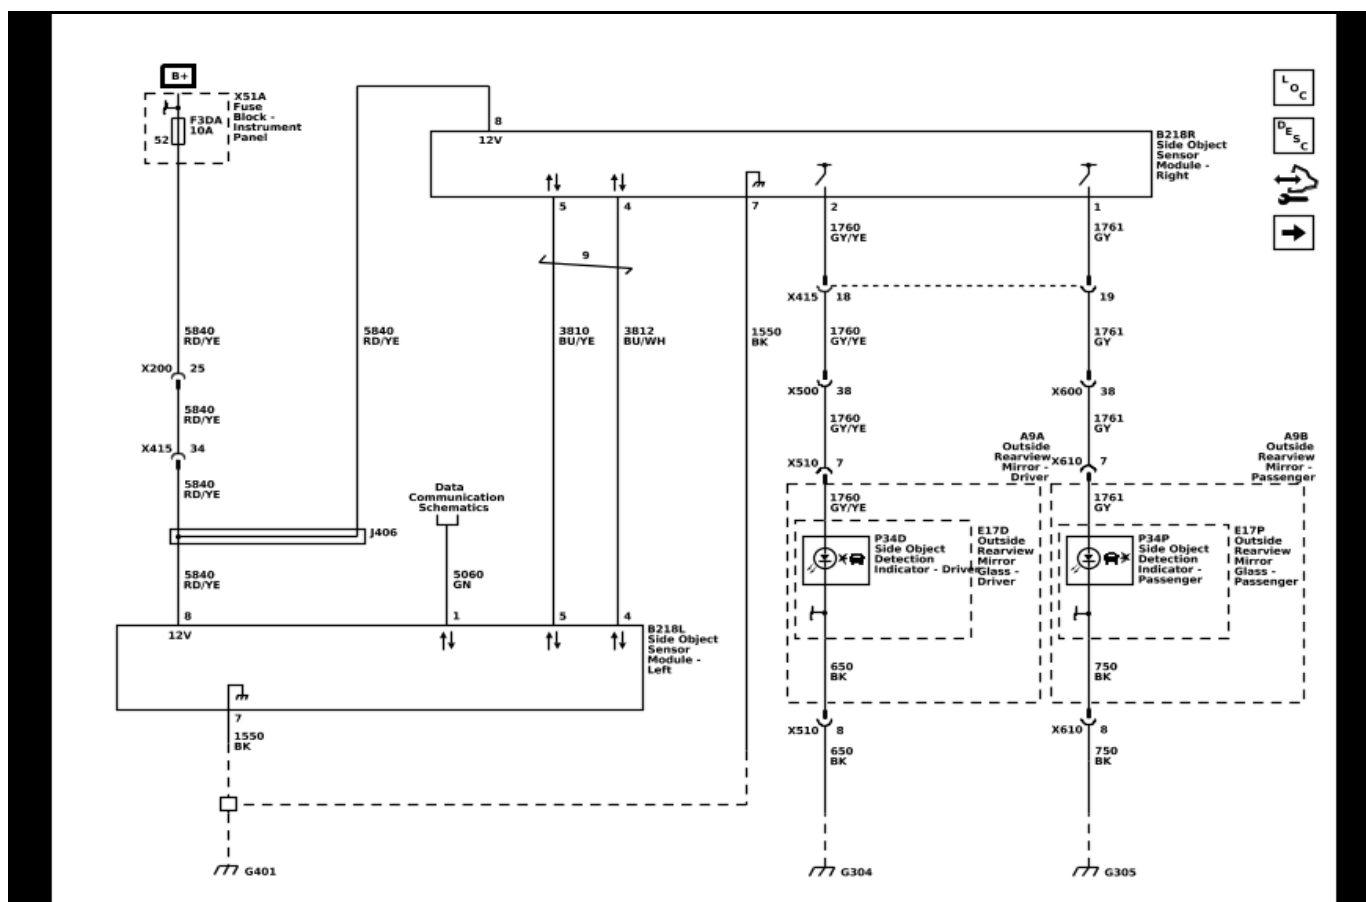

4811651

2. Inspect the LED circuit in the mirror for corrosion. Refer to Rear Cross Traffic Alert (UFG) and Side Object Detection (UKC) (Document ID #4817118) in SI.
 - " If any corrosion IS found, it will be necessary to replace the mirror assembly. Refer to Outside Rearview Mirror Replacement in SI.
 - " If NO corrosion is found, reinstall the mirror and follow the DTC B094C (39) diagnostics referenced in SI.

Parts Information

Use the VIN and refer to the GMElectronic Parts Catalog (EPC) to determine the proper part to order.

Causal Part	Description	Part Number	Qty
X	MIRROR ASM-O/S RR VIEW	42690694 (Rt. Hand)	1
		42553500 (Rt. Hand)	
		42779315 (Rt. Hand)	
		42779313 (Rt. Hand)	
		42690697 (Rt. Hand)	
		42690696 (Rt. Hand)	
		42736385 (Rt. Hand)	
		42736384 (Lt. Hand)	
		42690693 (Rt. Hand)	
		42553501 (Lt. Hand)	
		42779314 (Lt. Hand)	
		42779312 (Lt. Hand)	
		42690698 (Lt. Hand)	
		42690695 (Lt. Hand)	

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2050220	Outside Rearview Mirror Replacement	Use Published Labor Operation Time

Version	2
Modified	Released July 15, 2020 Revised January 20, 2023 – Updated the Cause, Service Procedure and Parts Information to note Condition could affect the driver or passenger side mirror.

