

	GROUP Electrical	MODEL 2017-18MY Forte (YDm) Soul (PS) Sportage (QL)
	NUMBER PS610 (Rev 1 06/26/2023)	DATE June 2019



TECHNICAL OPERATIONS

SUBJECT: SRS DTC B176200 AND/OR B168400

 NOTICE

This pitstop has been revised to include additional information. New/revised sections of this pitstop are indicated by a black bar in the margin area.

This Pitstop provides information regarding a possible mismatch of a SRSCM (Supplemental Restraint System Control Module) and driver seat belt buckle that may set the SRS DTC(s) B168400 and/or B176200 on the models listed below. When diagnosing a vehicle that has been in an accident and/or has recently had a superseded SRSCM replaced, it may be necessary to inspect and replace the driver seat belt buckle with the latest production P/N listed in EPC. Older production driver seat belt buckles have a 4 pin connector and may no longer be compatible with the superseded SRSCM. Only the SRSCM is superseded; the driver seat belt buckle is not superseded.

DTC B176200: ACU Coding Error
DTC B168400: Not Configured Device is Detected

Model	MY	SS SRSCM P/N	Updated Driver Seat Belt Buckle P/N
YDm	2017-18	95910 B0100	88830 B0550 <u>XX</u>
PS		95910 B2600	88830 B2550 <u>XX</u>
QL		95910 D9050	88830 D9550 <u>XX</u>

Note: Add the applicable “XX” color code per VIN to the required/applicable Part Number.