

Technical product information

Topic	Air suspension warning light within the DIP - DTC's P089200 - C104707 - C103B13 - Evident within Address 74		
Market area	Australia E04 Bentley rest Asia and Australia (6E04),China 723 Volkswagen (Anhui) Automotive CO (6723),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Arab Emirates E06 Bentley Middle East and Africa (6E06),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)		
Brand	Bentley		
Transaction No.	2062259/6		
Level	EH		
Status	Released for publishing		
Release date	03-Oct-2023		

Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
0074 - Chassis control	P089200: TCM Power Relay Sense Circuit Intermittent		Intermittent
0074 - Chassis control	P089200: TCM Power Relay Sense Circuit Intermittent		static

New customer code

Object of complaint	Complaint type	Position
running gear -> shock absorber/suspension control -> roll compensation	functionality -> defective function sequence	
lighting system, signalling -> sound signals -> accoustic warning for shock absorber/suspension control	functionality -> warning signal sounds without reason	
information, navigation, communication, entertainment -> symbolic control indicators -> warning lamp for electronic stabilisation programme (ESC)	functionality -> activates without reason	
information, navigation, communication, entertainment -> symbolic information indicators -> anti-roll bar decoupling indicator	functionality -> activates without reason	

New workshop code

Object of complaint	Complaint type	Position
electrical power, electric system, data transfer -> battery management -> de-energise	functionality -> cannot be activated	
electrical power, electric system, data transfer -> power supply -> high-voltage battery	electrics -> voltage too high	

Vehicle data

New Continental GT / GTC & New Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*
3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S3*	2022	E		*	*	*
3S3*	2023	E		*	*	*
3S3*	2024	E		*	*	*
3S4*	2019	E		*	*	*
3S4*	2020	E		*	*	*
3S4*	2021	E		*	*	*
3S4*	2022	E		*	*	*
3S4*	2023	E		*	*	*
3S4*	2024	E		*	*	*
ZG2*	2020	E		*	*	*
ZG2*	2021	E		*	*	*
ZG2*	2022	E		*	*	*
ZG2*	2023	E		*	*	*

ZG2*	2024	E		*	*	*
------	------	---	--	---	---	---

Documents

Document name
master.xml

Customer statement / workshop findings

Customer statement:

Air suspension warning light within the DIP

Workshop findings:

One or a combination of the DTC's shown below are evident within address 74

- P089200 - Symptom Code 3145792 - TCM Power Relay Sense Circuit Intermittent (Level Control Valves Open Circuit)
- C103B13 - 3145909 - Solenoid for level control system Open circuit
- C104707 - 3211279 - Level control valves mechanical malfunction

Technical background

Refer to the Measure section of this TPI

Production change

.

Measure

1) Conduct a wiring integrity check between the (Valve block for adaptive suspension) NX7 and the (Running gear control unit - J775) as follows:

T81aa Pin 79 + T3da Pin 1

T81aa Pin 78 + T3da Pin 2

T81aa Pin 59 + T3da Pin 3

TIP: *Previous instances have highlighted the following after inspection:*

- Broken wires
- Kinked wiring
- Pin/s missing
- Pin/s broken
- Pin/s loose

NOTE: Refer to the example shown in Figure 1 of a damaged wiring harness



Figure 1

2) Repair any broken or damaged wires as per Rep.Gr 97



If the event that No fault is found with the integrity of the afore mentioned wiring circuits - Perform electrical integrity and visual inspections of the connectors

- Conduct a wiring integrity check between the Valve block for adaptive suspension control unit (NX7) and the Running gear control unit (J775)



Should no issues be found regarding the integrity/visual checks please raise a new DISS query or respond to the previously opened DISS query

Warranty accounting instructions

Time to conduct wiring integrity checks

New Flying Spur

Warranty Type	110 or 910
Damage Service Number	43 23
Damage Code	00 15

Labour

Labour Operation Code 43 13 01 10
Time 60 TU

New Continental GT

Labour

Labour Operation Code 43 13 01 10
Time 60 TU

New Continental GTC

Labour

Labour Operation Code 43 13 01 10
Time 80 TU

Wiring repairs

Labour

Labour Operation Code 97 09 41 52
Time 40 TU