



Technical Service Bulletin

01 MIL / EPC Light on, DTC P042000 or P043000, (Catalyst System, Bank 1 or 2 Efficiency Below Threshold)

01 23 97 2072121/1 November 20, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A5, A5 Cabriolet, S5, S5 Cabriolet, RS 5, and RS 5 Cabriolet	2014 – 2015	All	Not Applicable

Condition

Customer states:

Various warning lamps are on in the instrument cluster (including MIL and/or EPC warning lamps).

Workshop findings:

One of or both of the following DTCs are stored in the ECM, J623 (address word 0001):

- **P042000:** Catalyst System, Bank 1 Efficiency Below Threshold – Symptom code 10434
- **P043000:** Catalyst System, Bank 2 Efficiency Below Threshold – Symptom code 10434

Technical Background

Under specific operating conditions, the above stated DTCs may be stored in the ECM, -J623- (address word 0001), resulting in activation of the various warning lamps in the instrument cluster (including MIL and/or EPC warning lamps).

Production Solution

Not applicable.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the ECM, -J623- (address word 0001) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
-------	--------------------------	----------------------	---	-------------------------------------	----------------



Technical Service Bulletin

RS 5, and RS 5 Cabriolet	8T2907560B	0001 - 0004	8T2907560F	0007	01A150
RS 5, and RS 5 Cabriolet	8T2907560F	0003 - 0006	8T2907560F	0007	

Warranty

Claim Type:	• 110 Up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2360		
Damage Code:	0039		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0010	See SRT with associated operations
Diagnostic Time:	GFF	0151 0060	(Max 15 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2072121/1		

All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Delete if not required.

Additional Information

All parts and service references provided in this TSB (XXXXXX) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may



Technical Service Bulletin

these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.