

Subject

Request for Detailed Reporting of Oil Leaks from A25A Engines

Market

USA

Service Category

Engine/Hybrid System

Section

Lubrication

Applicability


Vehicles with A25A Engines

APPLICABLE VEHICLES

2020-2022	Avalon HV	2020-2024	Highlander HV
2020-2024	RAV4	2020-2024	Camry
2020-2024	RAV4 HV	2020-2024	Camry HV
2021-2024	Sienna HV		

CONDITION

Engine Oil Leak between the Lower Oil Pan and Crank Case

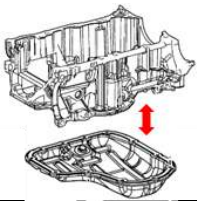

RECOMMENDATIONS

Please report (via DPR or FTR) oil leaks and include the following information:

- Macro photos (far away) of both entire sides of the sealing surface (lower oil pan **and** crank case side)
Examples:



Continued on Next Page

Subject

Request for Detailed Reporting of Oil Leaks from A25A Engines

Applicability

Market

USA


RECOMMENDATIONS

2. Micro photos (close up) of the suspected leak path in the FIPG
Examples:



3. Notation if you suspect:
 - a. Insufficient or lack of FIPG (poor diameter of bead)
 - b. Mis-location of FIPG (off centered bead)
 - c. Any gaps in FIPG
 - d. Insufficient adherence of the FIPG (not sticking to one of the surfaces)

Example diagram of different application conditions:

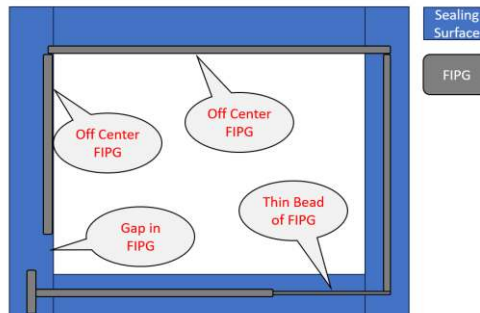

LINK REFERENCES

This Tech Tip does not contain any link references

[Click here to enter text.](#)