

**IMPORTANT SERVICE
INFORMATION FOR:**

- ✓ SERVICE MANAGER
- ✓ SERVICE ADVISOR
- ✓ TECHNICIAN
- ✓ PARTS DEPARTMENT
- ✓ WARRANTY PERSONNEL

BULLETIN NUMBER:

SB24-L-001

ISSUE DATE:

FEBRUARY 2024

GROUP:

MISCELLANEOUS**DTC P20EE DEF CONTROL UNIT RECALIBRATION****AFFECTED VEHICLES**

- 2022i – 2024MY Isuzu N-Series
Equipped with 5.2L 4HK1 Diesel Engines

CONDITION

Some customers may experience an illuminated Malfunction Indicator Light (MIL) with DTC P20EE Diesel Exhaust Fluid (DEF) System NOx Trap Low Efficiency set without an apparent cause. New calibrations for the DEF Control Unit (DCU) have been developed to address this concern.

Follow the diagnostic for this DTC. If no fault can be found when performing the normal diagnosis, follow the service procedure in this bulletin to reprogram the DEF Control Module.

SERVICE PROCEDURE

Reprogram the DCU with the latest software and calibration using the Isuzu Diagnostic Service System (IDSS) if the calibration part number does NOT match the calibration numbers listed in the table below:

MY	Vehicle	Engine	Trans	Calibration #
2022i	N-Series	5.2L	AUTO	55229784
2023-2024	N-Series	5.2L	AUTO	55228945

NOTE: If the calibration number IS listed above, follow the Intermittent Conditions diagnostics in the applicable Workshop Manual.

WARRANTY INFORMATION

For vehicles repaired under warranty, use:

Labor Operation Code	Description	Labor Time
L8006	DTC P20EE DCU Recalibration	0.4