

V O L V O

Volvo Car USA LLC

Technical Journal

Technical Journal Title DTC SRS-B15381B High Voltage battery loop control		Ref. No. TJ 36754.2.0	
Issuer (Dept.) Technical Service		Issue Date 2/29/24	Status Date 3/14/24
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA		Function Group 4300
Function Description Gearbox		Page Page 1 of 2	

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

If customer complains of warning message "Transmission Service Required" in DIM and DTC stated below is set with no other symptoms, follow advise under "Service".

CSC Customer Symptom Codes

Code	Description
7G	Text window and warning symbol/Yellow symbol and text message
IV	Text window and warning symbol/Text message
DL	Warning lights and chimes/Malfunction Indicator Light ("Check engine" light) indication/no indication

DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
TCM	P288772	Intermittent
TCM	P288772	Permanent

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224	L1	BL1KERS					2024-2024		-	202317-202407
227	L1	BL1KERS					2024-2024		-	202317-202407
236	L1	BL1KERS					2024-2024		-	202317-202407
246	L1	BL1KERS					2024-2024		-	202317-202407
256	L1	BL1KERS					2024-2024		-	202317-202407
536	K9	BK9KERS					2024-2024		-	202317-202407
536	L1	BL1KERS					2024-2024		-	202317-202407

Technical Journal 36754.2.0

SERVICE:

*** Do not replace the transmission.**

* An improved TCM software is available for download with VIDA as of 2-26-2024 and is planned to be available via OTA shortly afterwards. This TCM software is contained within vehicle software version **2.14.3**.

For additional software release information and timing, see *VIDA Release Notes*. This software will be distributed via the latest OTA release. If the car has not yet received it via OTA, please perform a software upgrade according to TJ 31543.

TCM - Transmission control module

OTA - Over the air

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Note that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
36004-2	Software Control Module downloading

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 4300.