



Service Bulletin

File in Section: -

Bulletin No.: PIP5147

Date: August, 2013

PRELIMINARY INFORMATION

Subject: SES Lamp P0300 P0351 - P0358

Models: 2014 Chevrolet Silverado 1500
2014 GMC Sierra 1500
Built with RPO's 4.3L 5.3L L83 LV3

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

If the vehicle has an engine misfire with any of the following codes.

P0351-P0358, P2300, P2301, P2303, P2304, P2306, P2307, P2309, P2310, P2312, P2313, P2315, P2316, P2318, P2319, P2321, or P2322

Recommendation/Instructions

Inspect the coil connectors for a clear water and/or a discolored connector.

If this is found inspect the pigtail for pin drag or loose terminals (repair as needed).

Swap the coil to a known good location.

If the concern follows the coil replace the coil or coils with the concern and add dielectric grease to the connection.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4020070	Ignition Coil Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.