



Technical Service Bulletin

01 MIL on, Start/Stop system fault, DTC P16D400 – 4 cyl 2.0L TFSI
01 24 25 2074099/1 May 29, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2018	All	Engine code DBPA

Condition

Customer states:

- The MIL is illuminated.
- “Start/stop system: fault” appears on instrument cluster.

Workshop findings:

- DTC P16D400: “Torque limit due to glow ignition” - symptom code 21139.

Technical Background

Software issue in the ECM, -J623- (address word 0001).

Production Solution

New software in the ECM -J623- (address word 0001) addresses the condition.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
2. Update the ECM, J623 (address word 0001) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version (or lower)	New Software Part Number	New Software Version	SVM Code Input



Technical Service Bulletin

MY18 A4	8W0907115C	0006	8W0907115C	0008	01A267
---------	------------	------	------------	------	--------

Warranty

Claim Type:	• 110 Up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Software update	0151 0060	Time stated on the diagnostic protocol (Max 60 TU)
Diagnostic Time:	Software update	0151 0010	See SRT with associated operations
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2074099/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2074099**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.



Technical Service Bulletin

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.