



Technical Service Bulletin

94 Warning lamp for exterior lighting displayed in instrument cluster: DTC U112100, U110B00, B126A29

94 24 83 2074786/1 July 31, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, S3, RS 3, Q4 e-tron, and Q4 Sportback e-tron	2022 – 2024	All	Not Applicable

Customer statement:

A warning lamp for the exterior lighting or adaptive light is displayed in the instrument cluster. The lighting system appears to be working as it should.

Workshop findings:

The concern can be reproduced. The following DTCs are stored in the onboard supply control unit J519 (address 0009):

- **DTC B126A29** Light switch Range/Performance.
- **DTC U112100** Data bus missing message.
- **DTC U110B00** Light switch no communication.

All lighting functions are working.

Technical Background 1

Diagnostic software too sensitive in the J519.

Production Solution

Optimized software planned for week 25/25.

Service

This TSB Closes PSS 20373612: *PSS Headlight 94 PSS Headlight warning in cluster, DTC : B126A29, U110B00 stored in 09 module.*

- Check whether the situation is as described above.
- Pressing the “AUTO” button will cause the warning lamp to go out and the DTC entry to change to intermittent.
- The DTC can then be deleted.





Technical Service Bulletin

If only DTC “U110B00 Light switch no communication” is stored without the other entries, the cause may be a loose connector, a pin that has been pushed back or a wiring problem.

NOTICE

Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor and gearbox code, PR number(s), part number, software version, code etc.) apply exactly. Otherwise, this solution will not eliminate the problem, and repeat repairs may be necessary. In such a case, we may reject the warranty claim and charge back the cost of the parts.

When billing, attach a photo that clearly shows the complaint to DOC-IT.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9405		
Damage Code:	0040		
Labor Operations:	Service light switch	9405 4199	Bill according to time required
Diagnostic Time:	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
Claim Comment:	As per TSB 2074786/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Not applicable

Additional Information

All parts and service references provided in this TSB (**2074786**) are subject to change and/or removal.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property



Technical Service Bulletin

rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.