



Service Bulletin

Bulletin No.: 24-NA-125
Date: August, 2024

INFORMATION

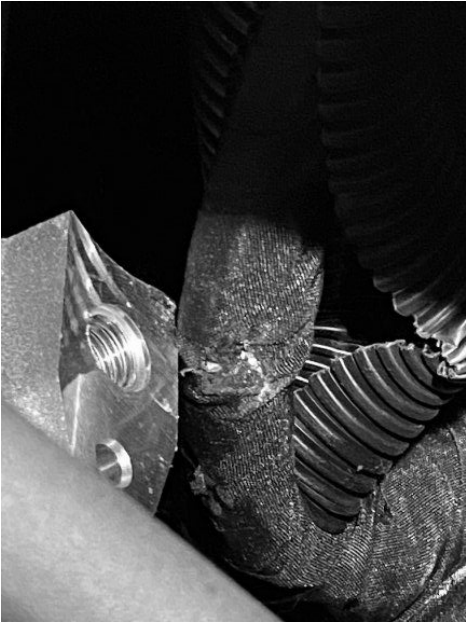
Subject: Diagnostic Tip: Antilock Brake System (ABS) Lamp Illuminated, Diagnostic Trouble Code — DTC's — C0513, C0514, C0515, C0516

This Service Bulletin replaces PIT6136. Please discard PIT6136.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado EV	2024	2024	-	-	All	All

Involved Region or Country	North America
Condition	Some customers may comment on an ABS light illuminated followed with a "Service Stability " message.
Cause	

6580315

	 6580193 The cause of the condition may be the ABS wiring harness making contact with the top edge of the rear drive unit (DU) above the right rear axle.
Correction	Inspect the location show above the right rear axle and repair wiring and re-route harness as needed.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*5486038	Wire to Wire Repair and Re-route Harness as Needed	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	Released July 10, 2024 Revised August 07, 2024 – Updated Warranty Information.