



Service Bulletin

Bulletin No.: 24-NA-172
Date: August, 2024

TECHNICAL

Subject: Intermittent No Power or Vehicle will Hesitate DTC P0700, P0EFF, U1611, U0401

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2024	2024	-	-	All	All
GMC	Canyon						

Involved Region or Country	North America, Middle East, GM Korea Company
Condition	Some customers may comment on intermittent no power or will hesitate. During this concern, the “D” and “L” will flicker on PRNDL and door locks cycle. During diagnosis a technician may find DTC P0700, P0EFF, U1611, U0401.
Cause	The cause of the condition may be due to an unsecured ground G201A.
Correction	If you encounter a vehicle with the above concern, clean and tighten the ground shown below.


Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

6719974

A - Fuse Junction Block

B - Ground that needs cleaned and tightened.

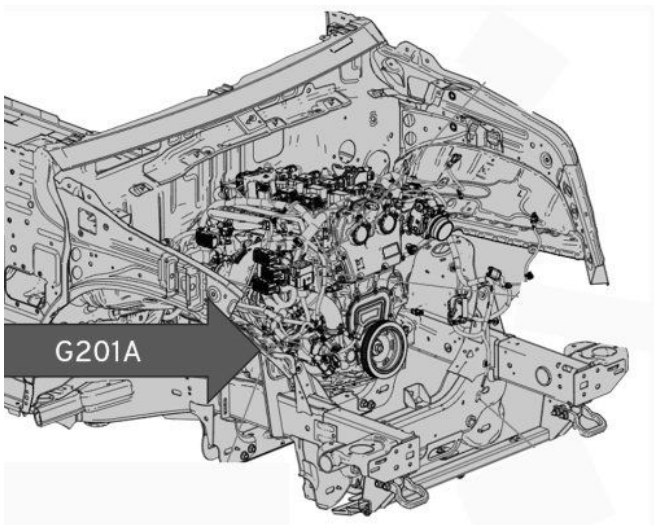

6719975

If you encounter a vehicle with the above concern, clean and tighten the ground shown above.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
5486048*	Ground Connection Repair for G201A	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released August 26, 2024

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION