



Technical Service Bulletin

45 Warning messages in instrument cluster, DTC P060C00 or DTC C051F00 are stored in the electric drive or ABS modules

45 24 51 2061908/5 September 10, 2024. Supersedes Technical Service Bulletin Group 45 number 23-33 dated May 25, 2023 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron	2019 2021 – 2023	All	Not Applicable
e-tron Sportback	2021 – 2023		
Q8 e-tron, Q8 Sportback e-tron, SQ8 e-tron, and SQ8 Sportback e-tron	2024		

Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised <i>Condition</i> (Updated Information) Revised <i>Service</i> (Updated Information) Revised <i>Warranty</i> (Updated Labor Operations)
4	05/23/2023	Revised header (Added Model Year)
3	06/09/2022	Revised header (Added Model Year)

Customer states:

- A yellow warning lamp with the message ("Drive fault") appears in the instrument cluster while driving.

Or

- Several warning messages (e.g. ESC message) appear in the instrument cluster after the power unit is started.

Workshop findings:

- DTC P060C00** with symptom codes 53312 and/or 53313 intermittent is logged in the diagnostic address 0051.

Or

- DTC C051F00** intermittent is logged in the diagnostic address 0003.



Technical Service Bulletin

Technical Background 1

Software optimization in diagnostic addresses 0003 and 0074.

Production Solution

In diagnostic address 0003 from software version 0272 onwards.

In diagnostic address 0074 from software version 2320 onwards.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the ABS control module, J104 (address word 0003), and the suspension control module, J775 (address word 0074) using the SVM action code as listed in the table below, if necessary:

Model	Control Module	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
Audi e-tron, and Audi e-tron Sportback	ABS	4KE909059AD	0231	4KE909059AF	0242	74A006
	Suspension	4KE907777AM	<2320	4KE907777AH	2320	

3. Proceed with basic settings for the electromechanical parking brake and the tire pressure monitoring system in the brake electronics (diagnostic address 0003).



NOTICE

If DTCs are logged in various control units after the update has been performed, please lock the vehicle and unlock it again a short time later. Then delete all DTCs before dealing with subsequent entries by performing the measure via GFF.

Warranty

Claim Type:	If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.
Service Number:	4316
Damage Code:	0039



Technical Service Bulletin

Labor Operations:	Charge battery	2706 8950	See SRT with associated operations
	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol
	GFF	No allowance	0 TU
Claim Comment:	As per TSB 2061908/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2061908**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.