



SSM 53223 2021-2023 F-150 - SuperCab With 163 Inch Wheelbase - Fixed Rear Parking Aid Camera (Non-360 Degree Camera) - DTC B115E:78 Stored In The IPMA And Unable To Complete Camera Alignment

Some 2021-2023 F-150 SuperCab vehicles with a 163 in. wheelbase equipped with a fixed rear parking aid camera but not the 360 degree view system, may exhibit a "Reverse Brake Assist Not Available See Manual" message in the instrument panel cluster (IPC) and diagnostic trouble code (DTC) B115E:78 stored in the image processing module (IPMA) after the camera alignment procedure was unable to complete. This may result in the active rear view camera guidelines not functioning properly and may be due to the software in the IPMA. To correct the concern, reprogram the IPMA using the latest software level of the Ford Diagnosis and Repair System (FDRS) diagnostic scan tool. For claiming, use causal part 14G647 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.