



Technical Service Bulletin

19 PSS Engine: Radiator blind - fault. Maximum speed limit to 10 mph A3 DTC's P05AF00, P05B200, P05A000, P05A300

19 24 72 2073088/2 December 3, 2024. Supersedes Technical Service Bulletin Group 19 number 24-56 dated April 5, 2024 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, S3, and RS 3	2022 – 2024	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Adjusted solution date) Revised <i>Warranty</i> (Updated Claim Types, Labor Operations)
1	04/05/2024	Initial publication

Customer states:

There is a message in instrument cluster: Radiator blind fault Maximum speed limited to 10 mph. please contact workshop.

Workshop findings:

The following DTC's are stored in ECM, J623 (address word 0001):

- **P05AF00** – active radiator blind 2 sticks open – with symptom 28397.

and/or

- **P05B200** – active radiator blind 2 lost communication – with symptom 2840.

and/or

- **P05A000** – active radiator blind 1 sticks open – with symptom 28396.

and/or

- **P05A300** – active radiator blind 1 lost communication – with symptom 28408.

Technical Background 1

- Engine control unit issue
- In rare cases the following message may be shown in the cluster Radiator blind fault Maximum speed limited to 10 mph. please contact workshop.
- The maximum speed limit should specify 100 mph rather than 10 mph.
 - Please refer to TSB 2074984 regarding a display of 10 mph rather than 100 mph.



Technical Service Bulletin

- In almost all cases the complaint is fixed after turning the ignition off and on again.
- Be aware that the complaint may reappear at speeds greater than 100 mph.

Production Solution

Not applicable.

Service

- If no fault is found with the component using GFF, then the memory entry can be deleted.
- Explain to the customer that a solution is expected to be available by the end of the 1st quarter of 2025 (subject to change) and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.
- Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*).

NOTICE

In many cases, the complaint is fixed after an ignition cycle.

Warranty

Claim Type:	• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	1935		
Damage Code:	0016		
Labor Operations:	GFF	0150 0010	See SRT with associated operations
	GFF	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2073088/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

All part and service references provided in this TSB (**2073088**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.