Bulletin No.: PIC6250B
Published date: 02/28/2017

Preliminary Information


PIC6250B Check engine light- P0446- Check EVAP canister for restriction


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Encore	2013 - 2017	All	All	All	All
Chevrolet	Sonic	2012 - 2017	All	All	All	All
Chevrolet	Trax	2013 - 2017	All	All	All	All

Involved Region or Country	North America
Condition	Check Engine Light ; P0446 or P0455
Cause	Restriction in fresh air inlet port caused by spiders

Correction:
Remove the evap canister vent cap and Inspect evap canister for spider nesting in the fresh air inlet port (see pictures). Replace evap canister.

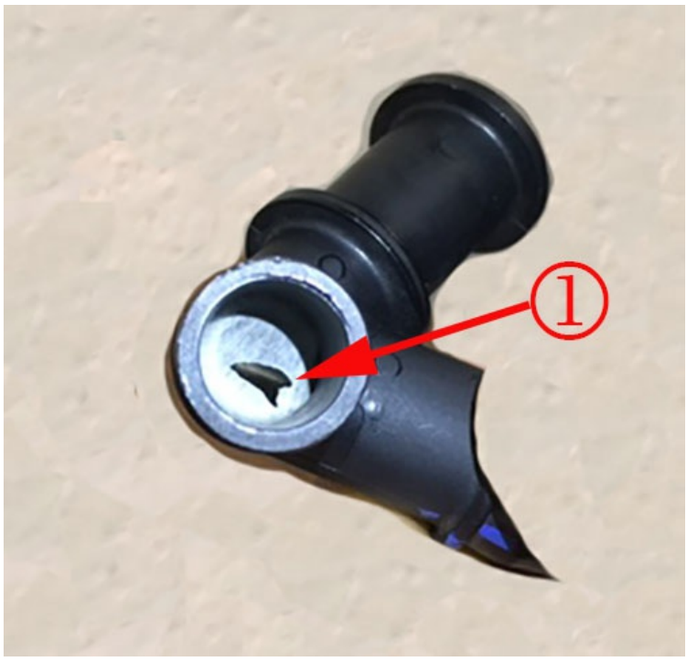

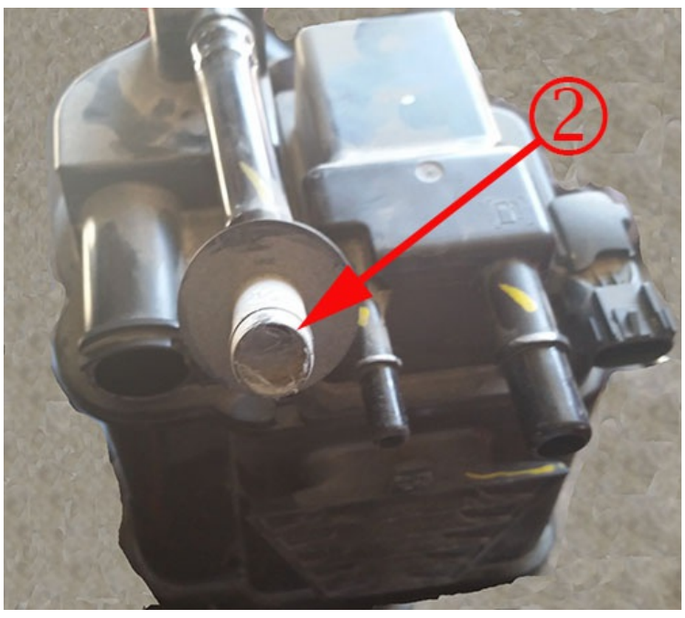



Parts Information

Description	Part Number	QTY
Sonic / Canister Kit	95174448	1
Encore, Trax / Canister	95128163	1

Warranty Information

Labor Operation	Description	Labor Time
4027950	Evaporative Emission Canister Replacement	Use Published Labor Operation Time
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	3
Modified	01-26-2017 Update Part information
	02-28-2017 Update Condition Field

©2016 General Motors. All Rights Reserved.