	GROUP	MODEL
	BOD	**2026MY Sorento Hybrid and Plug-In Hybrid (MQ4 P/HEV)**
	NUMBER	DATE
	359	**September 2026**

TECHNICAL SERVICE BULLETIN

SUBJECT:

SERVICE ACTION: FRONT VIEW CAMERA REPLACEMENT (SA656)

This bulletin provides information to replace the front view camera on certain 2026MY Sorento Hybrid (MQ4 HEV) and Sorento Plug-In Hybrid (MQ4 PHEV) vehicles produced from January 09, 2026 through January 15, 2026. The affected vehicles may exhibit various warning lights illuminated on the instrument cluster accompanied by DTC(s) C160449 and/or C160649 due to unstable voltage input from the front view camera. If the DTC(s) listed are stored, certain camera-related ADAS functions may become inoperative, accompanied by associated warning lights/messages. Follow the procedure outlined in this publication to replace and calibrate the front view camera on the applicable vehicle. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

DTC Description:
C160449 - ECU Hardware Error
C160649 - ECU Software Error

NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on KDealer+ (Service → Warranty → Warranty Coverage Inquiry). Not completed Campaign reports are available on KDealer+ (Service → Campaigns → Open Campaign Report), which includes a list of affected vehicles.

This issue number is SA656.


A printed copy is for reference only; publication information can be updated at any time.
Always refer to KGIS for the latest information. After logging in kdealer.com, the newest technical publications are listed in 'Service Releases' and has the latest service information that has been released.

Kia America, Inc. Confidential

SUBJECT: SERVICE ACTION: FRONT VIEW CAMERA REPLACEMENT (SA656)


Replacement Procedure:

1. Replace the Front View Camera (A) by referring to "Advanced Driver Assistance System (ADAS) → Advanced Driver Assistance System (Driving) → Front Camera → Removal and Installation" in the applicable Shop Manual on KGIS.

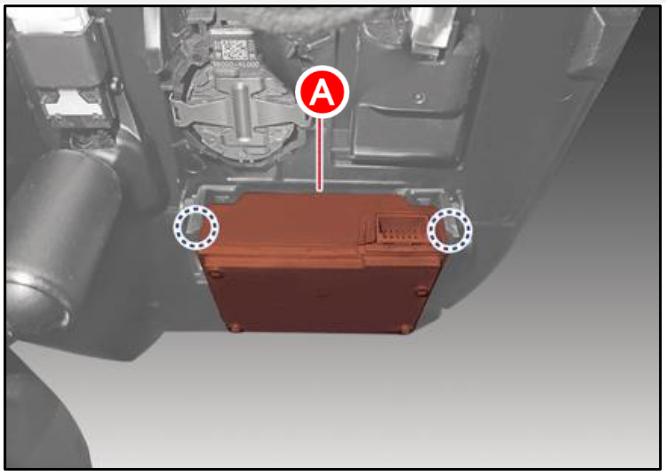


⚠CAUTION

Remove the blanking cover (B) by hand. Using a pry tool/screwdriver can damage the headliner and/or blanking cover.

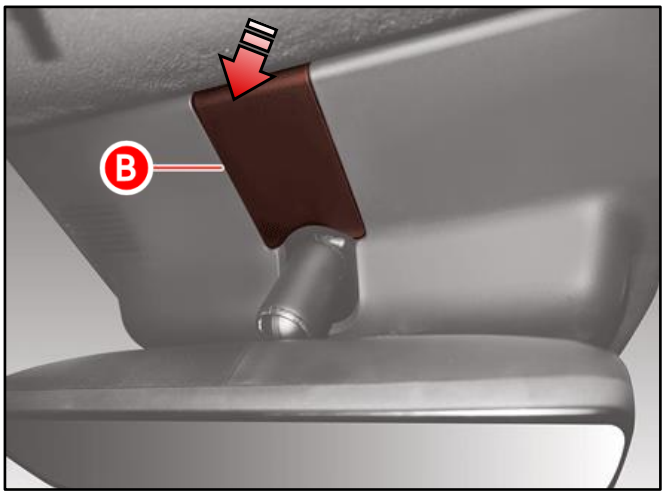

⚠CAUTION

To avoid breaking the clips/tabs, slide the sensor cover (C) down while pressing it against the windshield.

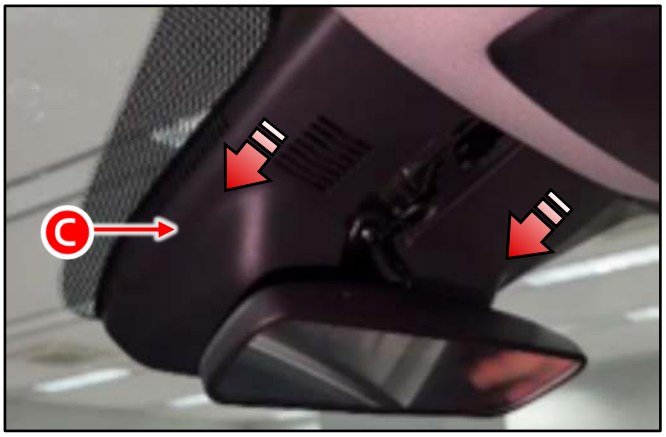

Printed document copy is for reference only; information may be updated at any time. Always refer to KGIS for the latest information.

2. Reinstall all removed parts in reverse order of removal.

⚠CAUTION

To help prevent breaking the clips/tabs when reinstalling the sensor cover (C), press the sensor cover against the windshield and slide up.






3a. Using the KDS, perform the 'Variant Coding' by referring to "'S/W Management → FR_CMR - Front View Camera → Variant Coding".

ⓘ IMPORTANT

Ensure the front camera mounting area (windshield) is clean BEFORE installing the front camera (A).

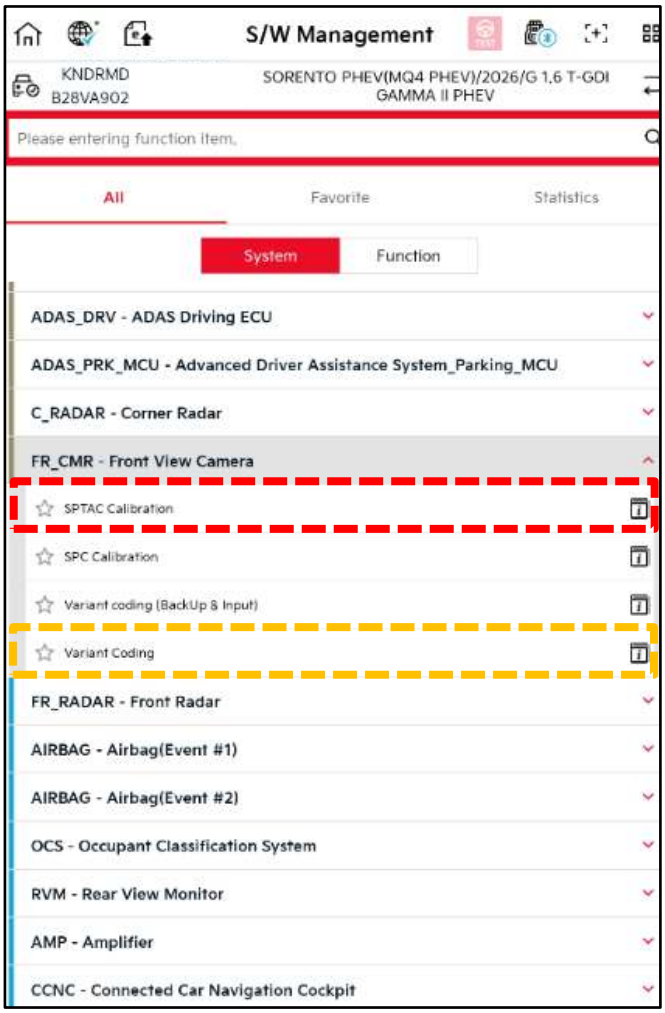

3b. Perform the Front View Camera Adjustment by referring to "Advanced Driver Assistance System (ADAS) → Advanced Driver Assistance System (Driving) → Front Camera → Adjustment" in the applicable Shop Manual on KGIS AND referring to "'S/W Management → FR_CMR - Front View Camera → SPTAC Calibration" using the KDS.

4. Using the KDS, clear any stored DTCs.

5. Confirm normal vehicle operation.

SUBJECT: SERVICE ACTION: FRONT VIEW CAMERA REPLACEMENT (SA656)


AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sorento Hybrid (MQ4 HEV)	January 09, 2026 to January 15, 2026
Sorento Plug-In Hybrid (MQ4 PHEV)	

AFFECTED VINS			
KNDRH4JG1T5485372	KNDRH4JG6T5484315	KNDRHDJG9T5483577	KNDRKDJGXT5485470
KNDRH4JG8T5485370	KNDRH4JG4T5484314	KNDRHDJG4T5484202	KNDRKDJG3T5485469
KNDRH4JGXT5485368	KNDRH4JG2T5484313	KNDRHDJG7T5483772	KNDRKDJG1T5485468
KNDRH4JG0T5485251	KNDRH4JG0T5484312	KNDRHDJG5T5483768	KNDRH4JG2T5485364
KNDRH4JG2T5485218	KNDRH4JG0T5484309	KNDRHDJG3T5483767	KNDRH4JG1T5485355
KNDRH4JG5T5485214	KNDRH4JG9T5484308	KNDRHDJGXT5483765	KNDRH4JG2T5485350
KNDRH4JG8T5485210	KNDRH4JG5T5484306	KNDRHDJG8T5483764	KNDRH4JG4T5485348
KNDRH4JG4T5485205	KNDRH4JG1T5484304	KNDRHDJG0T5483760	KNDRHDJG0T5484732
KNDRH4JG1T5484805	KNDRH4JG8T5484302	KNDRHDJG4T5483759	KNDRHDJG9T5484731
KNDRHDJG3T5484353	KNDRH4JGXT5484298	KNDRHDJG7T5483755	KNDRHDJG5T5484726
KNDRHDJG1T5484352	KNDRH4JG8T5484297	KNDRHDJG5T5483754	KNDRHDJG8T5484722
KNDRHDJG1T5484349	KNDRH4JG6T5484296	KNDRHDJG1T5483752	KNDRHDJG6T5484721
KNDRHDJGXT5484348	KNDRH4JG0T5484293	KNDRHDJGXT5483751	KNDRHDJG4T5484720
KNDRHDJG8T5484347	KNDRH4JG7T5484288	KNDRHDJG8T5483750	KNDRHDJG8T5484719
KNDRHDJG0T5484343	KNDRH4JG3T5484286	KNDRHDJG6T5483729	KNDRHDJG6T5484718
KNDRHDJG9T5484342	KNDRH4JG4T5484281	KNDRHDJG9T5483725	KNDRHDJG4T5484717
KNDRHDJG7T5484341	KNDRH4JG6T5484279	KNDRHDJG8T5483716	KNDRKDJG5T5484632
KNDRHDJG5T5484340	KNDRH4JG0T5484276	KNDRH4JG2T5483713	KNDRKDJG3T5484628
KNDRHDJG7T5484338	KNDRH4JG7T5484274	KNDRHDJG5T5483687	KNDRKDJG2T5484622
KNDRHDJG5T5484337	KNDRH4JG5T5484273	KNDRHDJGXT5483684	KNDRKDJG9T5484620
KNDRH4JG3T5484336	KNDRH4JG3T5484269	KNDRHDJG0T5483676	KNDRKDJG5T5484565
KNDRH4JG1T5484335	KNDRH4JGXT5484267	KNDRHDJG5T5483611	KNDRKDJGXT5484562
KNDRH4JG8T5484333	KNDRHDJG0T5484259	KNDRH4JG3T5483607	KNDRKDJGXT5484559
KNDRH4JG4T5484331	KNDRHDJG2T5484246	KNDRH4JG0T5483600	KNDRKDJG6T5484557
KNDRH4JG4T5484328	KNDRH4JG5T5484242	KNDRH4JG4T5483597	KNDRKDJG0T5484554
KNDRH4JG0T5484326	KNDRH4JG8T5484235	KNDRH4JG0T5483595	KNDRKDJG4T5484511
KNDRH4JG9T5484325	KNDRH4JG4T5484233	KNDRH4JG9T5483594	KNDRKDJG1T5484501
KNDRH4JG7T5484324	KNDRHDJG0T5484228	KNDRH4JG8T5483585	KNDRKDJG3T5484497
KNDRH4JG5T5484323	KNDRHDJG7T5484226	KNDRH4JG6T5483584	KNDRHDJG6T5484220
KNDRH4JG3T5484322	KNDRHDJG3T5483817	KNDRH4JG2T5483582	KNDRHDJGXT5484219
KNDRH4JG1T5484321	KNDRHDJGXT5483779	KNDRKDJG0T5485476	KNDRHDJG7T5484212
KNDRH4JGXT5484317	KNDRHDJG0T5483774	KNDRKDJG3T5485472	KNDRHDJG3T5484210
KNDRH4JG8T5484316	KNDRHDJG9T5483773	KNDRKDJG1T5485471	KNDRHDJG5T5484208
		KNDRHDJG0T5484195	KNDRHDJG0T5483581

SUBJECT: SERVICE ACTION: FRONT VIEW CAMERA REPLACEMENT (SA656)

REQUIRED TOOL:

Tool Name	SST Number	Figure	Location	Comments
Vertical/Horizontal Laser	09964 C1200		Toolbox 1 Drawer 9	N/A
Calibration Target (Correction Jig for LDWS/LKAS)	09890 3V100		SHOP	N/A

REQUIRED PART:

Part Name	Part Number	Figure	Qty.	Comments
Front View Camera	99211 P2600QQK		1	N/A

Note: The replacement part number will require a VIN entry for parts ordering. DO NOT order these parts for stocking purposes, related to this Service Action. Supply is very limited. Until supply stabilizes, please confirm part availability before scheduling customers. Please be sure to expedite warranty claim filing.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	99211 P2600	0	(SA656) Front View Camera Replacement	260307R0	0.6 M/H	99211 P2600QQK	1

Note: When substitute transportation is provided, manually enter sublet code 'X2' for rental expense reimbursement or one roundtrip rideshare expense.

NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA656 when accessing the KDealer+ system.