HYUNDAI Technical Service Bulletin	GROUP **CAMPAIGN**	NUMBER **26-01-079H**
	DATE **OCTOBER 2026**	MODEL(S) **PALISADE HYBRID (LX3 HEV)**

SUBJECT: HYBRID WARNING LIGHT ON – HPCU SOFTWARE UPDATE – DTC P0C381C (SERVICE CAMPAIGN 9D8)

★ IMPORTANT

Dealers must perform this service campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

Access the "Vehicle Information" screen via WebDCS to identify open campaigns.

Description: Certain Palisade Hybrid (LX3 HEV) vehicles may display a Hybrid system warning light on the instrument cluster with Diagnostic Trouble Code (DTC) P0C381C when the vehicle is parked for long durations. This bulletin provides instructions to perform a Hybrid Power Control Unit (HPCU) software update to resolve this condition.







Applicable Vehicles (Certain):

Model Year	Model	Production Dates
2027	Palisade Hybrid (LX3 HEV)	06/01/2026 – 07/01/2026

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

Parts Information:

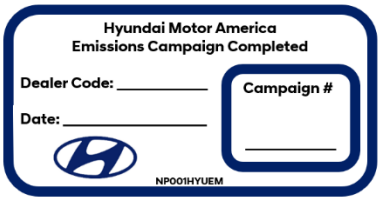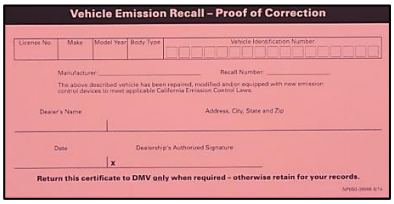Model	Part Name	Part Number	Figure	Remarks
Palisade (LX3)	Hyundai Emissions Label	NP001-HYUEM		Apply to all vehicles regardless of state.
	Vehicle Emission Recall - Proof of Correction Card	NP050-09006		Order only for states: CA, CO, CT, DE, ME, MD, MA, MN, NJ, NV, NY, OR, PA, RI, VA, VT, WA

SST Information:

Tool Name	Tool Number	Figure	Ordering Information
VCI 3	G0VHNNN06		Website: https://hyundaiessentialtools.com/ Email: Hyundaitools@snapon.com Phone: 1-855-763-9199 Hours: 7 AM – 7 PM CST
VCI 2	G1XDDMN001		

NOTE: VCI 2 can **NO** longer be ordered but can be used for the updates in this TSB.

GDS Information:

Model	System	Event Number*	Description
Palisade Hybrid (LX3 HEV)	MCULDC	1515	LX3 HEV HPCU S/W Update

(*or use a later available event listed in the GDS **MCULDC** Update screen if one is available.)

NOTE: When available, the software update is subject to an OTA (Over-the-Air) option and may be completed by customers with an active Bluelink subscription.

Warranty Information:

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
Palisade Hybrid (LX3 HEV)	60D259R1	HPCU Software Update & Emissions Label Application	0.4 M/H	36601-3UAC0	I11	ZZ3

NOTE 1: Submit a campaign claim on the "Claim Entry/Edit/Submit" screen on WebDCS and attach all required Digital Documentation per TSB to the claim.
NOTE 2: If any part(s) not subject to this TSB are found in need of replacement while performing the repair procedure, and the affected part(s) are still under warranty, the dealer may submit a separate claim using the same repair order. If the part(s) not subject to this TSB are out of warranty coverage, the dealer has the option to submit a PA Request for goodwill consideration on a case-by-case basis.
NOTE 3: This TSB includes repair validation photos. Op times include VIN, mileage, and photo capture of the ECU Update “Success” result screen as outlined in the Digital Documentation Policy.

ROM ID Information:

Model	Event	System	Part Number	ROM ID	
				Current	Latest
Palisade Hybrid (LX3 HEV)	1515	MCULDC	36601-3UAC0	2651LX3MHBNCAS10 2653LX3MHBNCAS21	2661LX3MHBNCAS22

Service Procedure:

DIGITAL DOCUMENTATION

This TSB includes repair validation photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

NOTICE

You must initially perform the GDS ECU update in Auto Mode.

- If the ECU update starts but then fails in Auto Mode, perform the update in Manual Mode to recover.

NOTICE


Ensure the vehicle's battery charge is **≥12.3 Volts** and the tablet's battery charge is **above 30%** before performing a software update, to avoid update failure. Hyundai recommends connecting a battery maintainer/charger when performing **all ECU updates**.

Information

- Turn **OFF** all lamps (do **NOT** leave head lamp switch in auto mode) and all accessories.
- Perform update with the ignition switch in the **ON** position.
- Do **NOT** disconnect any cables connected to the vehicle or scan tool during the update.
- Do **NOT** place the vehicle in **Ready** mode during the update.
- Do **NOT** turn **OFF** the ignition switch during the update.

ECU Update Procedure


1. Perform the ECU update in **Auto Mode**.

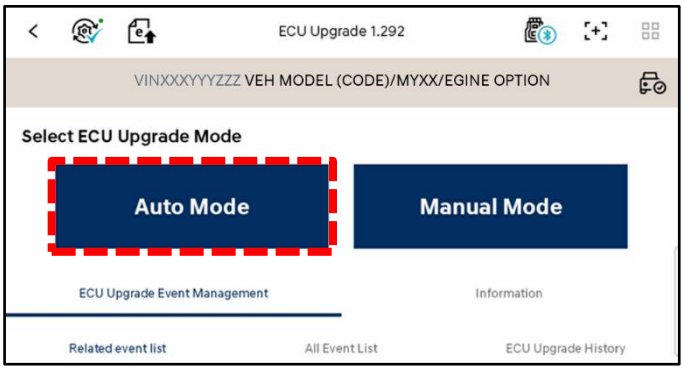

Information

Refer to **TSB # 25-GI-011H**, "**ECU Update Procedure for Tablet-Based GDS-Smart**", for additional information.

2. Verify the ROM ID by selecting the **MCULDC** system to scan the vehicle's current ROM ID.

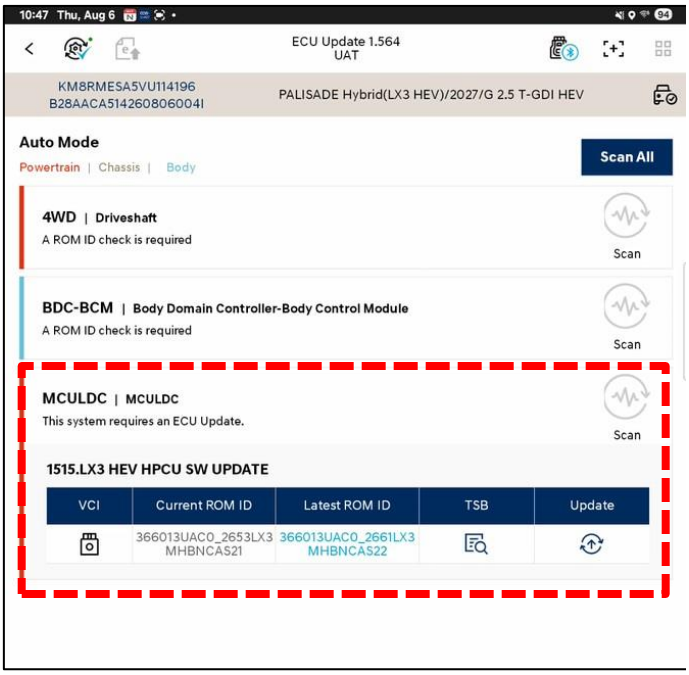

NOTICE


Check the current ROM ID version and compare it to the ROM ID Information table before attempting to perform the software update.

If the update fails, remove the power connector from the in-cabin fuse box for at least **5 seconds**. Reassemble and retry the update.

3. After the ECU update process shows 100% complete, follow the prompts on the screen to cycle the ignition **OFF** for at least **10 seconds** to reset the control unit.

Information

Use the **Refresh** button to reset the timer.

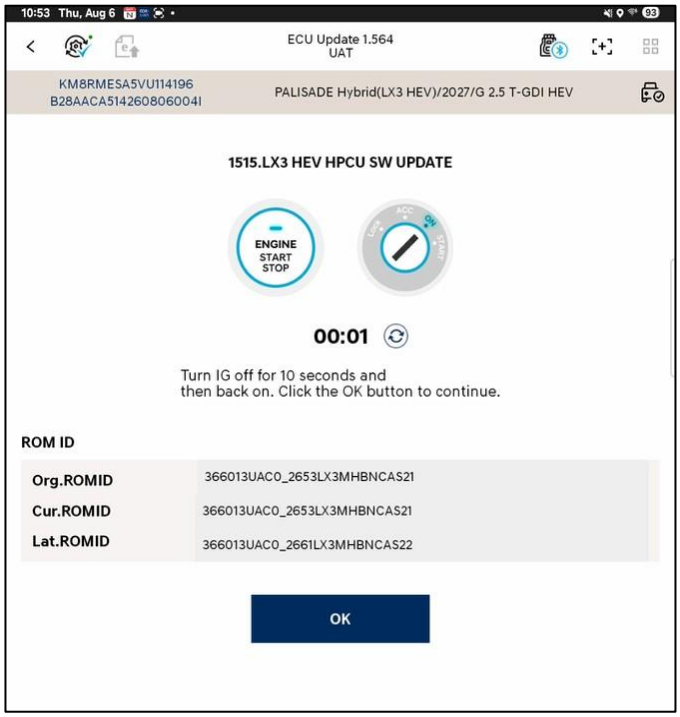


4. ***DIGITAL DOCUMENTATION***

Using the tablet or GDS screen capture function, take a screenshot of the ECU Update "Success" result screen.

Upload the photo to STUI.

NOTE: The VIN/Date/Time/Mileage photo imprint is **NOT** required for GDS screenshots.

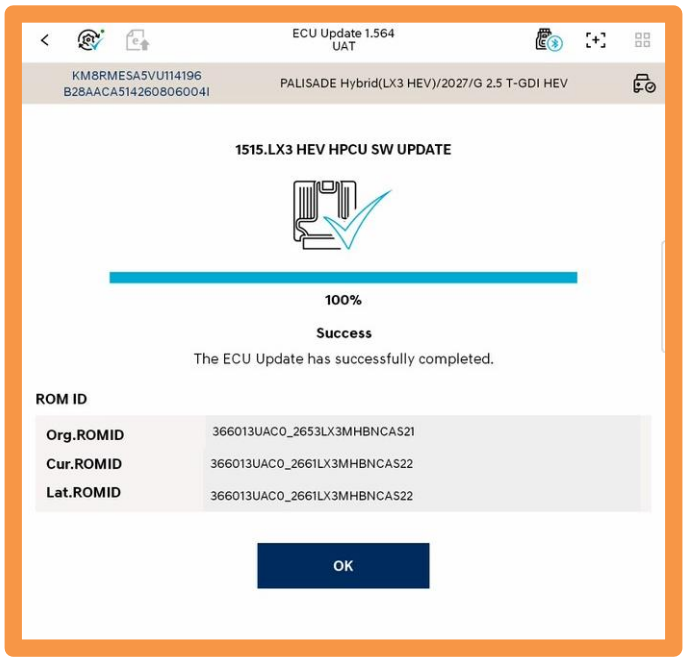

5. Perform an **All Systems Fault Code** search and erase DTC history that had incidentally occurred from the ECU update.

Information

If some DTCs cannot be cleared, select **OBD-II** menu on the main GDS home screen to scan and clear the DTCs.



6. Place vehicle in **Ready** mode to confirm proper operation of the vehicle.

7. Proceed to the **Emissions Label Application (for All Vehicles)** section.

NOTICE

If the ECU update fails in Auto Mode, perform the update in Manual Mode using the password(s) below.

Manual Mode Password:

Event	Menu	Password
1515	LX3 HEV HPCU SW UPDATE 36601-3UAC0	0386

Emissions Label Application (for All Vehicles)

1. Fill in the Campaign ID, Dealer Code, and Date on the emissions label, and apply adjacent to the existing label, on the underside of the hood, as shown.

   Be sure to clean the mounting surface to ensure proper label adhesion.



2. ***DIGITAL DOCUMENTATION***

   Using the STUI camera function, take a photo of the emissions label attached to the vehicle.

   Upload the photo to STUI.

   NOTE: If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



3. Proceed to the next section and complete the **Vehicle Emission Recall - Proof of Correction Card** for the states listed.

   If **NOT** applicable to your state, the repair process is complete.

Vehicle Emission Recall – Proof of Correction Card (for Vehicles Registered in Certain States)

For vehicles registered in California, Colorado, Connecticut, Delaware, Maine, Maryland, Massachusetts, Minnesota, Nevada, New Jersey, New York, Oregon, Pennsylvania, Rhode Island, Vermont, Virginia, and Washington:

VEHICLE EMISSION RECALL - PROOF OF CORRECTION CARD

A Vehicle Emission Recall - Proof of Correction card must be filled out for all vehicles registered in California, Colorado, Connecticut, Delaware, Maine, Maryland, Massachusetts, Minnesota, Nevada, New Jersey, New York, Oregon, Pennsylvania, Rhode Island, Vermont, Virginia, and Washington. Residents of these states, who own an affected vehicle, will be required to possess a Vehicle Emission Recall - Proof of Correction card as evidence of voluntary service campaign completion, when they apply for vehicle registration renewal.

WHAT TO DO WITH THE CARD:

The Vehicle Emission Recall - Proof of Correction card must be completed by the Dealership's Service Manager using a permanent ink pen. A fine point pen is recommended. When filling in the information, copy the information directly from the vehicle, not from the repair order.
ALL INFORMATION MUST BE PRINTED AND NEAT.

The copy of the card shown below indicates the areas to be filled in. Each area must be filled in.

A completed Vehicle Emission Recall - Proof of Correction card should be given to the owner of the vehicle upon completion of the Campaign.

1. Enter Vehicle's License Number
2. Enter "Hyundai"
3. Enter Model Year
4. Enter Model (e.g. **Palisade Hybrid**)
5. Enter the vehicle's VIN
6. Enter Campaign Number – **9D8**
7. Enter Dealership Name
8. Enter Dealership's Address
   NOTE: Enter the physical address, not the mailing address (not a P.O. Box)
9. Enter Date of Repair
10. Service Manager Sign Here

