STELLANTIS
PARTS & SERVICES

Technical Service Bulletin (TSB)

Evap / Fuel Line Quick Connect Exposed Near Exhaust

REFERENCE:	**TSB:** 14-011-26 **GROUP:** 14 - Fuel	**Date:**	October 31, 2026	**REVISION:**	—
VEHICLES AFFECTED:	**2026 (WS) Jeep Wagoneer / Grand Wagoneer** **This bulletin applies to the vehicle built on or after April 14, 2026 (MDH 0414XX) and on or before April 18, 2026 (MDH 0418XX) equipped with 3.0L Twin Turbo Six Pack SO ESS (Sales Code EFH).**			**MARKET APPLICABILITY:** ☒ NA ☐ MEA ☐ SA ☐ IAP ☐ EE ☐ CH **NOTE: This bulletin applies to the North American market.**	
CUSTOMER SYMPTOM:	**Customers may experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle may exhibit/set the following Diagnostic Trouble Code (DTC):** • P0456-00 EVAP System Small Leak.				
CAUSE:	**Exposed evap / fuel line quick disconnects**				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-215, date of issue October 31, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/ Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting and possibly repositioning the evap / fuel line quick disconnect heat shields.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-70-10-94	Evap / Fuel Line Shields - Inspection (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
14-70-10-95	Evap / Fuel Line Shields - Inspect And Reposition (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
Failure Code	ZY	Service Action	

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RSU VIN list, perform the Repair procedure. **This bulletin only applies to vehicles on the RSU VIN list.**

REPAIR PROCEDURE:

1. Raise and support the vehicle. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info> 04 - Vehicle Quick Reference / Hoisting / Standard Procedure.
2. Inspect the evap / fuel line quick disconnects Fig. 1.

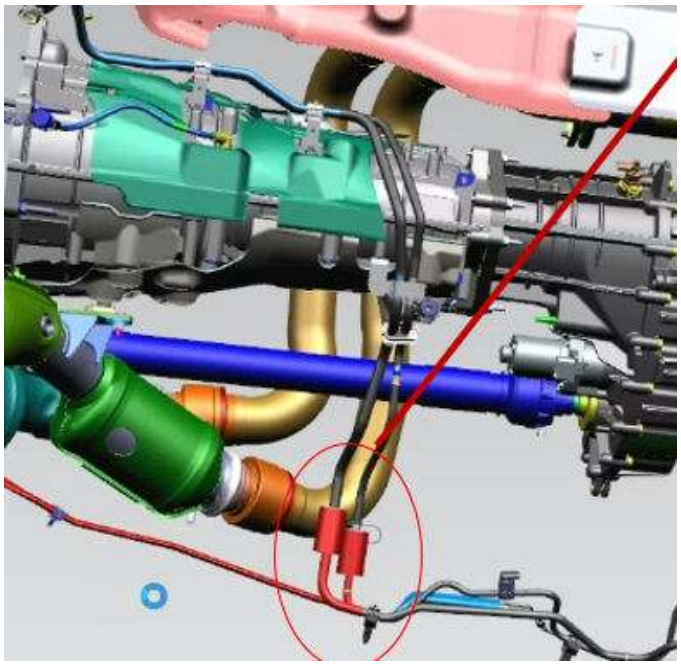


Fig. 1
Fuel Line Quick Disconnects Location

3. Are the evap / fuel line quick disconnect heat shields improperly positioned, exposing the evap / fuel line quick disconnects Fig. 2?

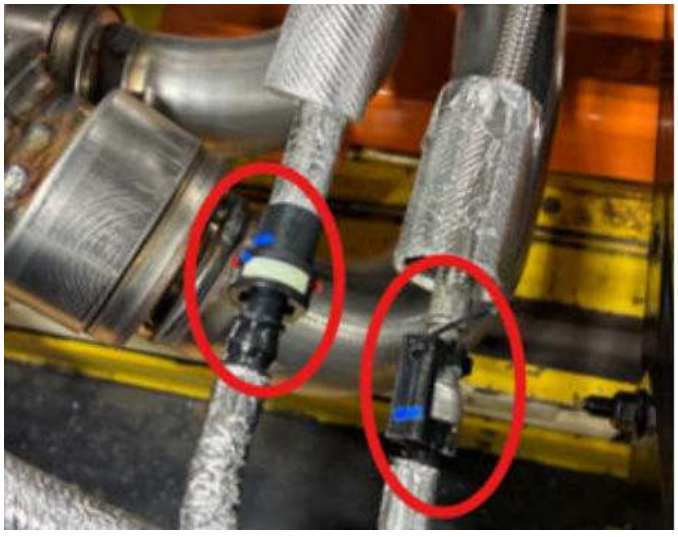


Fig. 2
Fuel/Evap Line Quick Disconnects Exposed

- YES>>> Proceed to Step 4.
- NO>>> This bulletin has been completed. Use Inspection LOP (14-70-10-94) to close the active RSU.

4. Reposition and secure the heat shields Fig. 3.

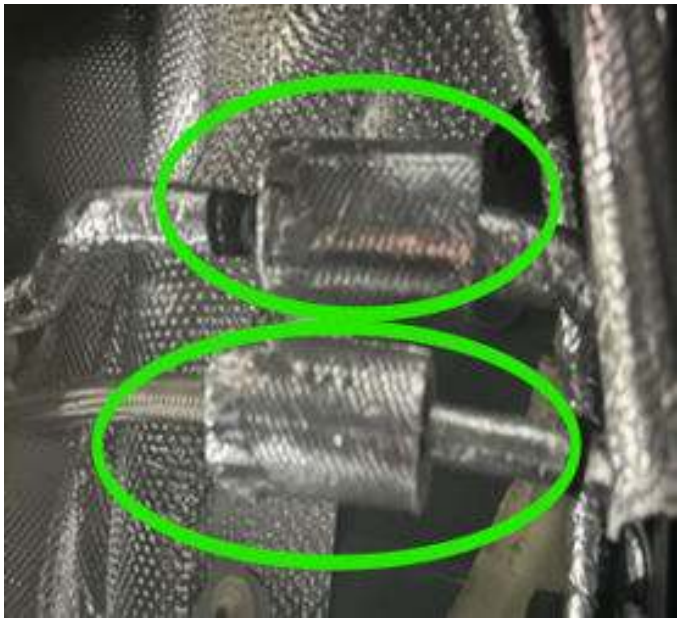


Fig. 3
Fuel Line Quick Disconnects Properly Shielded

5. Lower the vehicle from the hoist and return it to the customer.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.