Connection offline

**Technical Service Bulletin**

Transaction No.: **2083828/1**

97 Workshop info: software update fails, control unit J1194 cannot be reached, entry U159600 in DA0009

Release date: Oct 30, 2026

## Condition


| Model(s) | Year(s) | VIN Range | Vehicle Specific Equipment |
|---|---|---|---|
| A5, and S5 | 2025 – 2026 | All | Not applicable |

A combined software update is aborted.

Rear right control unit for break-in protection 4 (J1194, diagnostic address 8121) cannot be reached.

**OR**

The following event memory entry (static) is logged in the onboard supply control unit (diagnostic address 0009): ***"U159600 Burglary Protection Control Module 4 rear right, no communication"***.

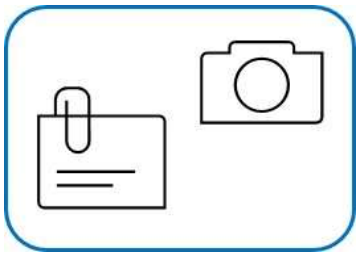

*Documentation required*

## Technical Background

A wire may be damaged by external influences.

## Production Solution

Additional wire protection is fitted on vehicles manufactured since 05/21/2026.

## Service

On rear right control unit for break-in protection 4 (J1194, diagnostic address 8121), check the red/grey terminal 30 wire at connector T6ak for damage or other irregularities.

If you find any irregularities, repair the affected wire as specified in the Workshop Manual using the wiring harness repair set VAS 1978 B/C.

After performing repairs, please fit protective cap 8K0971921K and secure it to the wiring harness with textile tape N10729002, wrapping the tape so that it overlaps.

When billing, please always attach a photo that clearly shows the complaint to the Doc-IT report. To ensure a reference to the vehicle, the photo must include the chassis number and the date. The photo must not be edited. The photo should be in focus and be taken with sufficient light. A high resolution is not necessary. If appropriate, please mark the location of the problem so that parts analysis have a clear reference to the complaint. Please ensure that the photo documentation does not show any persons and/or faces, vehicle registration numbers (number plates) or customer data.

## Warranty

The TSB number must always be noted in the “HST number” field in SAGA/2 for ease of processing.

If you are billing according to the warranty guidelines, please note the following accounting instructions:

| | | | |
|---|---|---|---|
| **Claim Type:** | • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. | | |
| **Service Number:** | 9725 | | |
| **Damage Code:** | 0033 | | |
| **Labor Operations:** | Remove and install KESSY control unit | 9666 1962 | See SRT with associated operations |
| | Repair wiring harness (depending on number of damaged wires) | 9709 41xx | See SRT with associated operations |
| | GFF / Guided Functions | 0150 0060 | Labor according to the diagnostic log |
| **Claim Comment:** | As per TSB 2083828/1 | | |

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

| Part number | Designation | Quantity |
|---|---|---|
| 8K0971921K | Protective cap | 1 |
| N10729002 | Textile tape | As required |

## Additional Information

All part and service references provided in this TSB (**2083828**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

**©2026 Audi of America, LLC / Audi Canada Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.