Bulletin No.: PI0931

Date: Mar-2013

Service Bulletin

PRELIMINARY INFORMATION


Subject: Service Engine Soon (SES) Light On with DTCs P0171, P1101, and/or P0101 Set

Models: 2013 Buick Verano

Equipped with 2.0L Engine (RPO LHU)

Condition/Concern

Some customers may comment that the service engine soon (SES) light is on. Upon further inspection, the technician may find P0171, P1101 and/or P0101 stored in history.

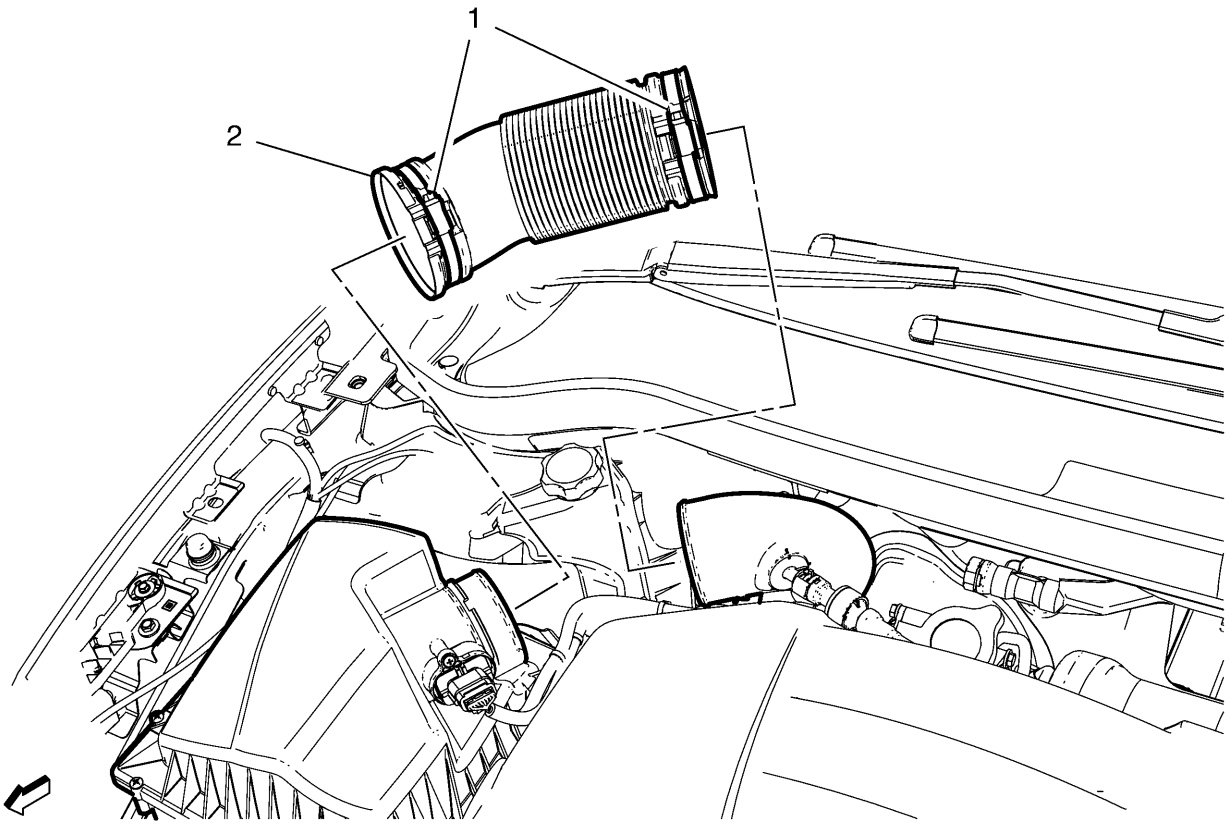

This condition may be caused by loose clamps on the air cleaner duct (1) as shown in the illustration above.

Recommendation/Instructions

Inspect both clamps on the air cleaner outlet duct to ensure that the clamps are secured tightly.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
J7956*	Inspect and Tighten Clamps on Air Duct	0.2 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION