

Check engine light illuminated - Fault code current P04D-B79 The crankcase ventilation system is interrupted.

Topic number	LI01.20-N-079115
Version	1
Function group	01.20 - Crankcase ventilation, cylinder head cover
Date	4/3/25
Validity	447 and 907 with M274
Reason for change	

Complaint

Check engine light on. Fault code P04DB79 is current in the engine control module (N3/10).

Cause


Open circuit or high resistance to crankcase vent line contact

Remedy

- 1. Check the electrical connector for S208 vent line contact switch. Refer to attached photo of connection location.
- 2. Ensure the bolted connection is secure and bolt can be torqued (9Nm).
- 3. Check continuity from vent line connection to ME control unit. Repair wire if damage is found.
- The circuit from ME provides 5V and is pulled to 0V when the ground connection is intact.

Note: This repair is not warrantable if the connection was left loose during previous repair/maintenance.

Attachments	
File	Description
M274 S208.png	

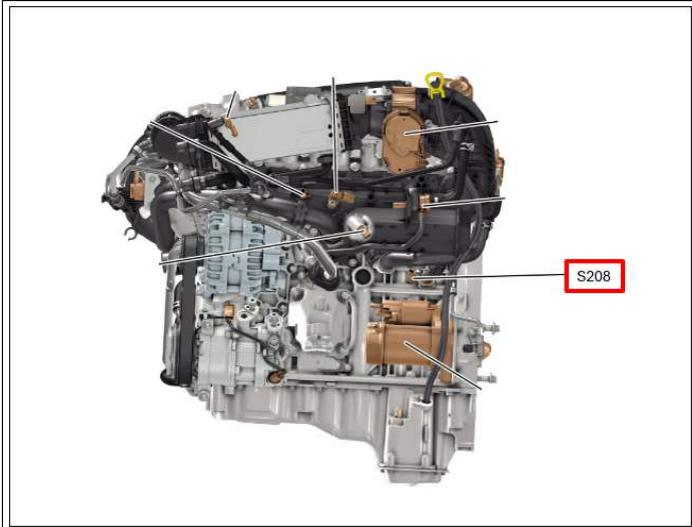

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms				
Power generation > Engine management > Indicator lamp > Engine diagnosis > lit				
Control unit/fault code				
Control unit			Fault text	
N3/34 - Motor electronics 'MED40' for combustion engine 'M274' (ME) (MED40)			P04DB79 - The crankcase ventilation system is interrupted. The mechanical connection has failed.	
Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note