

Technical Bulletin

Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Jetta GLI, Passat	2012-2014	All	All	All	All

Condition

69 13 05 October 16, 2013 2035369

Airbag Warning Lamp ON, DTCs B200009, B200049 or U101200 Stored in Airbag Control Unit

If fault codes other than those listed below are present, bulletin does not apply.

DTC:	Description
B200009	Transm.Contr. Unit Malfunction
B200049	Internal Contr.Module Random Access Memory (RAM) Error
U101200	Voltage supply voltage too high

Technical Background

The airbag control unit self-test may be susceptible to alarm horn resonance during the self-test causing the airbag light to illuminate in the instrument panel.

If this situation occurs, the airbag system remains operational.

Production Solution

Not applicable.


Service

- Install an alarm kit and replace the airbag control unit.

Technical Bulletin

Procedure:

- Install alarm kit part number 5C6998003 (Jetta) 561054620B (Passat) following instructions provided in kit.

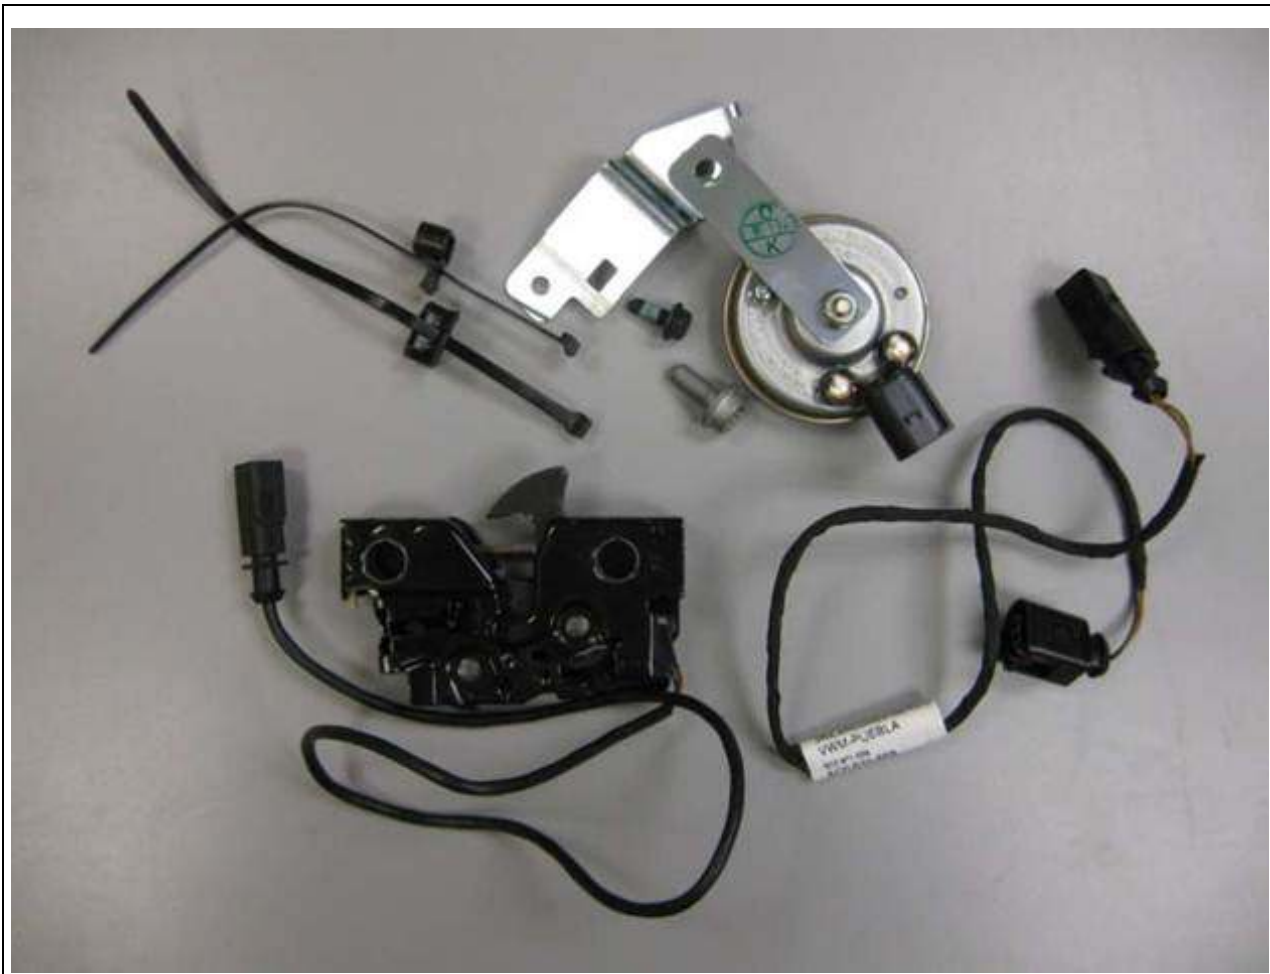


Tip:

If necessary, installation instructions are also available on [ServiceNet](#).

Technical Bulletin

- Select: Technical references>Accessories> Alarm.

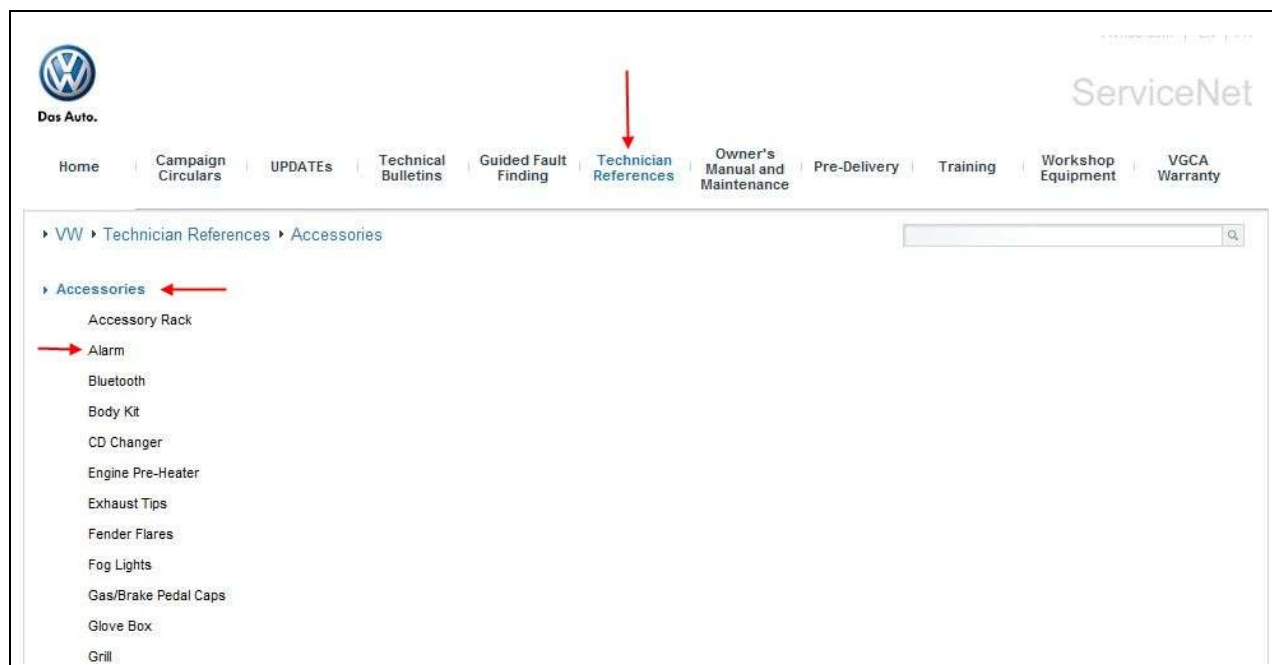

- Select appropriate vehicle.



- Once alarm kit is installed, replace airbag control module.

Technical Bulletin

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Jetta GLI , Passat	2012-2014	All	All	All	All
SAGA Coding					
Claim Type:	Use applicable Claim Type ¹⁾				
Service Number:	Damage Code	HST	Damage Location (Depends on Service No.)		
6953	0010	--	Use applicable when indicated in ElsaWeb (L/R)		
Parts Manufacturer	Passat			TX6 ²⁾	
	Jetta GLI			3ME ²⁾	
Labor Operation ³⁾ : Install Alarm Kit		90501999 = 50 TU			
Labor Operation ³⁾ : Install Air Bag Control Unit (Jetta GLI)		69531900 = 50 TU			
Labor Operation ³⁾ : Install Air Bag Control Unit (Passat)		69531900 = 70 TU			
Causal Part: Air Bag Control Unit		5C0959655			
Diagnostic Time ⁴⁾					
GFF Time expenditure	01500000 = 30 TU max.			YES	
Road Test	01210002 = 00 TU 01210004 = 00 TU			NO	
Technical Diagnosis	01320000 = 00 TU max.			NO	

Technical Bulletin

Claim Comment: Input "As per Technical Bulletin 2035369" in comment section of Warranty Claim.

- ¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only
- ²⁾ Code per warranty vendor code policy.
- ³⁾ Labor Time Units (TUs) are subject to change with ELSA updates.
- ⁴⁾ Documentation required per Warranty Policies and Procedures Manual.

Required Parts and Tools

Part No:	Part Description	Quantity
5C6998003	Alarm Kit (Jetta)	1
561054620B	Alarm Kit (Passat)	1
5C0959655*	Air Bag Control Unit	1

* This is a base part number. Please refer to ETKA for color coding.

No Special Tools Required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.