

Subject		Market
HV Battery Replacement due to P0A80		USA
Service Category	Section	
Engine/Hybrid System	Hybrid/Battery Control System	
Applicability		
2012-2017 Prius C		

APPLICABLE VEHICLES

2012-2017


Prius C

CONDITION

Some customers may complain about a MIL "ON" with a P0A80 DTC. In these cases, the HV Battery would need to be replaced. Along with the HV Battery replacement, the cooling system filter will need either cleaning or replacement. This TT provides information about the HV Battery cooling system filter.

RECOMMENDATIONS


- For vehicles produced prior to Sep. 2013 install a new filter G923G-52010
- For vehicles produced after Sep. 2013 clean the dust off filter
- Remove "Front Floor Cover for inspection" under rear seat on the driver side to inspect the filter

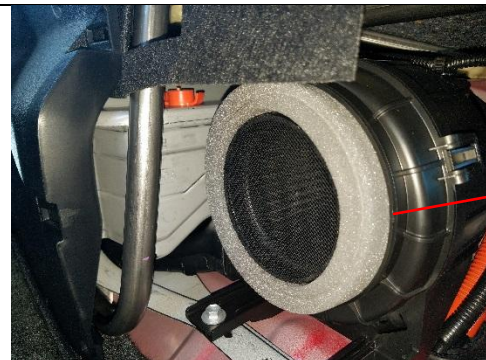

Filter mounted on the blower



Remove filter for cleaning

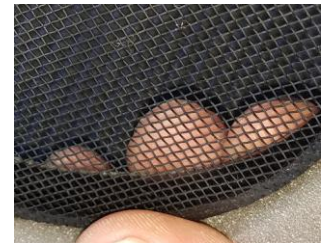

New tighter mesh filter was implemented in Sep. 2013

LINK REFERENCES

1. [HYBRID / BATTERY CONTROL: BATTERY BLOWER: COMPONENTS; 2012 MY Prius C \[12/2011 - ???????\]](#)