



Service Bulletin

PRELIMINARY INFORMATION

Subject: Service StabiliTrak ABS AWD Suspension Control And / Or SES MIL

Models: 2010-2015 Chevrolet Equinox

2010-2015 GMC Terrain

With Any Combination of DTCs C0196 C0186 C0287 C0710 C0045 C0050 C0800 U0077 U0074 U0125 U0126
U0100 U0101 U0121 U0415 U0432 U0121 U0140



The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some customers may comment on the following issues:

- SES Mil
- Service ABS
- Service StabiliTrak
- Service AWD
- Service Suspension Control
- Hard Steering
- Any of the following DTCs: C0196 C0186 C0287 C0710 C0045 C0050 C0800 U0077 U0074 U0125 U0126 U0100 U0101 U0121 U0415 U0432 U0121 U0140

These concerns may be caused by corrosion in the X411 connector located under the rear of the vehicle, behind and to the left of the fuel tank.

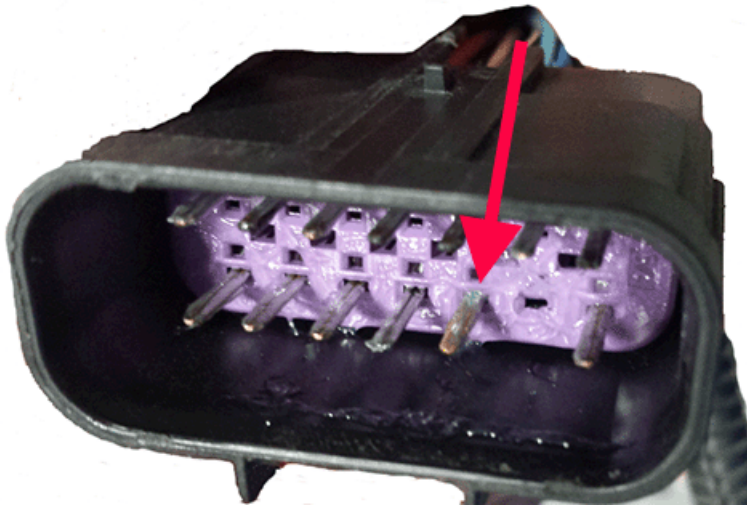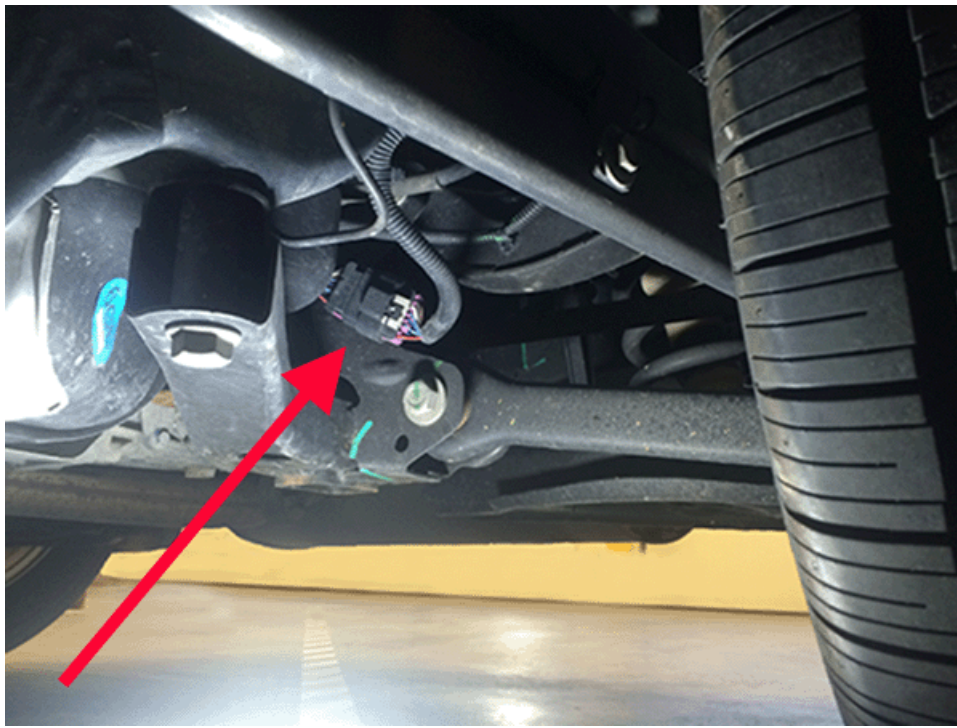

Recommendation/Instructions

To correct concern, please replace the appropriate terminals / connector at X411 as needed.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION