

STAR ONLINE PUBLICATION

Case Number: S2008000135

Release Date: 08/29/2020

Symptom/Vehicle Issue: MIL Lamp On Engine Runs Rough, DTC P0306 Cylinder Number Six Misfire

Customer complaint/ technician observation: Owner complains MIL (Malfunction Indicator Lamp) is on and the engine runs rough. Technician observed the vehicle was a low mileage vehicle with a stored DTC, P0306 Cylinder Number Six Misfire.

Discussion: Verify PCM software has no updates. Disconnect the XY232A black 24 connector and inspect K18 circuit for any terminal damage. Repair with 68232809AA repair kit as needed Fig 1, 2.

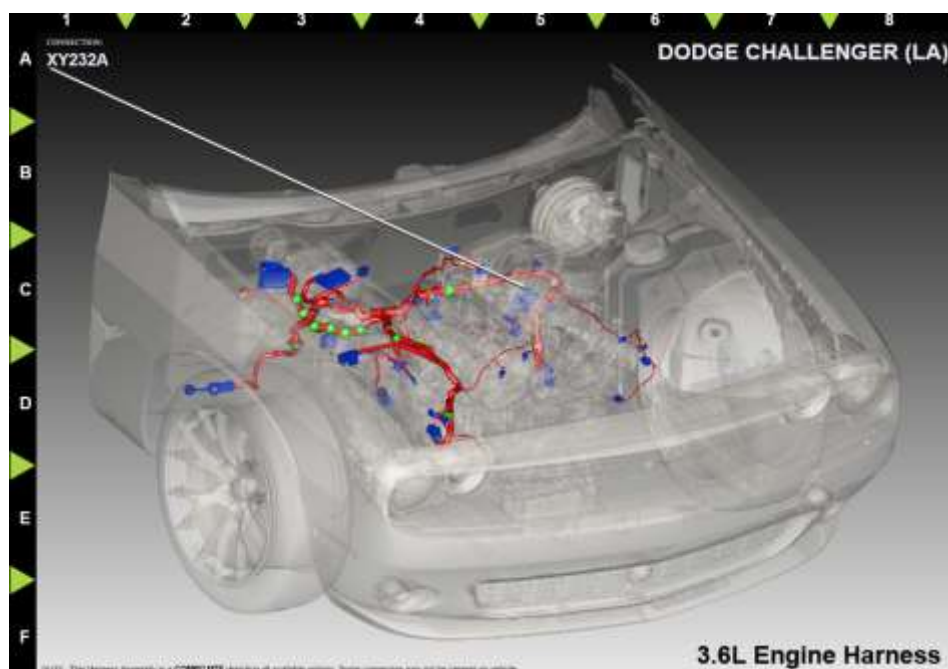


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

STAR ONLINE PUBLICATION

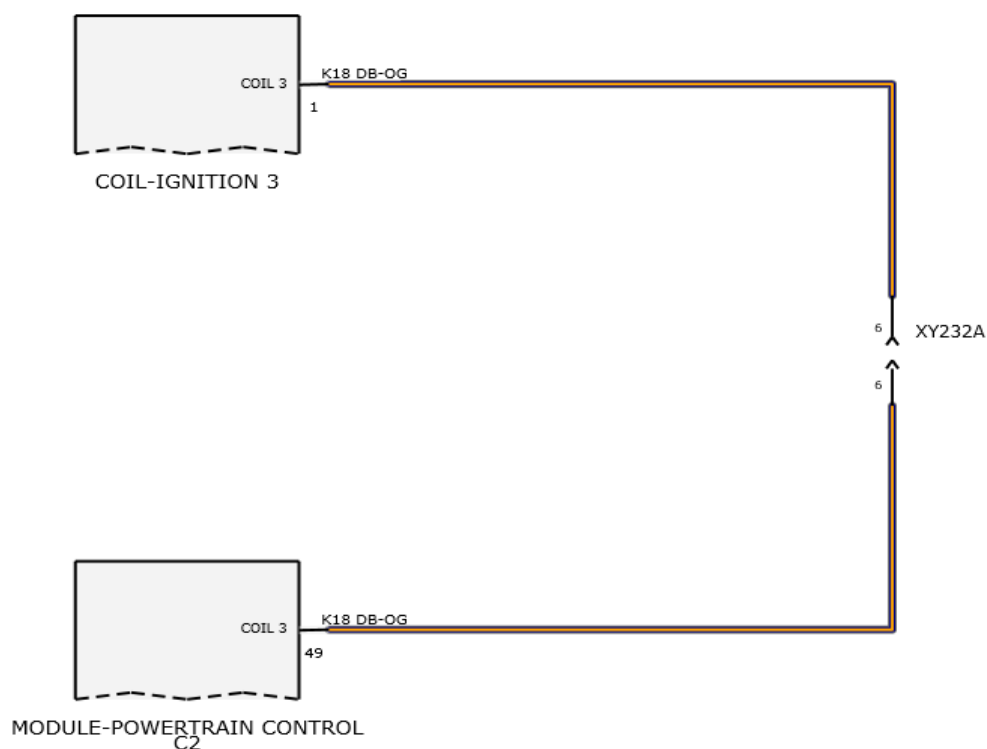


Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found