



TECHNICAL SERVICE BULLETIN

Classification:

DA22-007

Reference:

NTB23-009

Date:

January 25, 2023

SERVICE INFORMATION FOR DTC C2581-78 AND C2581-92 STORED IN THE LASER/RADAR SYSTEM

APPLIED VEHICLES: 2021-2023 Rogue (T33)

SERVICE INFORMATION

If DTC C2581-78 (Distance sensor) and/or DTC C2581-92 (Distance sensor) are stored in the LASER/RADAR system, please refer to the **SERVICE PROCEDURE** on page 2 for the updated ESM procedure.

HINT: This bulletin will be used to amend the ESM and mirrors the current ESM layout. Published times are available in the Flat Rate Warranty Manual, if needed.

For additional information and illustrations, refer to the ESM: **CRUISE CONTROL & DRIVER ASSISTANCE > DRIVER ASSISTANCE SYSTEM > DRIVER ASSISTANCE SYSTEM**

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. VISUAL INSPECTION

Check distance sensor and distance sensor bracket for damage or looseness.

Does damage or looseness exist?

YES>>

1. Repair or replace affected components. Refer to Removal and Installation.
2. Perform distance sensor alignment. Refer to Work Procedure.

NO>>

GO TO 2.

2. CHECK DISTANCE SENSOR SELF-DIAGNOSIS RESULTS

Is "C2581-78/92" detected in "Self Diagnostic Result" of "LASER/RADAR"?

YES >>

1. Perform distance sensor alignment. Refer to Work Procedure.
2. Perform "All DTC Reading".
3. Erase all self-diagnosis results with CONSULT.

Is "C2581-78/92" detected as the current malfunction?

YES >>

Replace the distance sensor. Refer to Removal and Installation.

NO >>

INSPECTION END

See page 3 for **Example of OK and Unwarrantable Condition**

Example of OK and Unwarrantable Condition

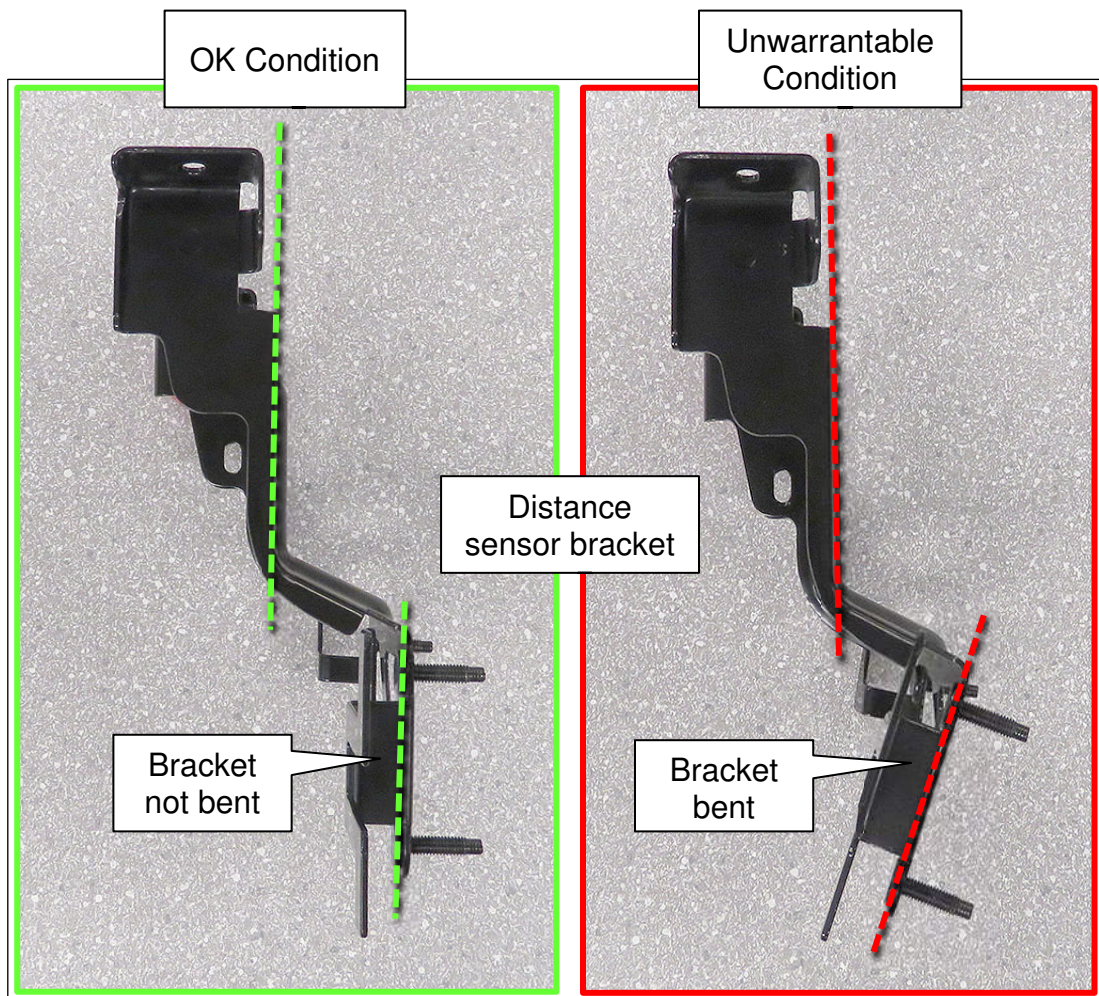


Figure 1

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
January 25, 2023	NTB23-009	Original bulletin published