



STAR ONLINE PUBLICATION




Case Number: S2205000001 Rev. A

Release Date: January 2023

Symptom/Vehicle Issue: Engine MIL Light On. P0572 Brake Switch 1 Stuck On. C1205-02 Brake Light Switch General Electric Failure.

Discussion: If a vehicle needs service due to MIL ON related to brake pedal switch DTCs C1205-02: Brake light switch - General Signal Failure & P0572: Brake Switch 1 Stuck On check for an unseated brake booster rod keeper clip before any part replacement or the brake pedal switch. See images below for reference.

Booster Rod Clip Location

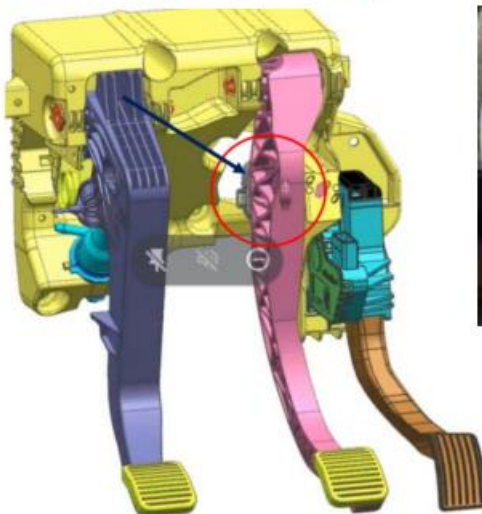

Booster Clip Visual




This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found



STAR ONLINE PUBLICATION

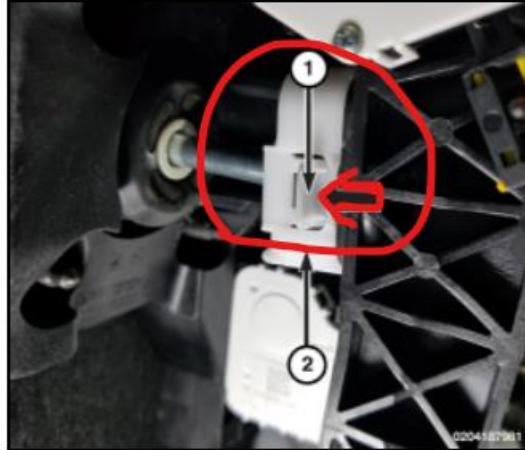

Clips engaged

Reference removal and installation steps in Service Library: 05 - Brakes / 05 - Brakes, Base / Hydraulic/Mechanical / PEDAL(S), Brake and/or Accelerator / removal and Installation

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found