



Preliminary Information

PIT6137 Diagnostic Tip - Service Park Brake Message / MIL DTC C15DD

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2500/3500	2020 - 2023	All	All	All	All
GMC	Sierra 2500/3500	2020 - 2023	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment that they are unable to clear DTC: C15DD after a park brake adjustment or replacing a park brake component.

Correction:

The following diagnostic tips may assist in clearing that DTC

1) Make sure the shoe clearance diameter, Seen Below in the released position, is adjusted to 226.5 mm (+/- 0.2). The smaller the value is, the more release time increases causing DTC C15DD SYM00 to reset right away.

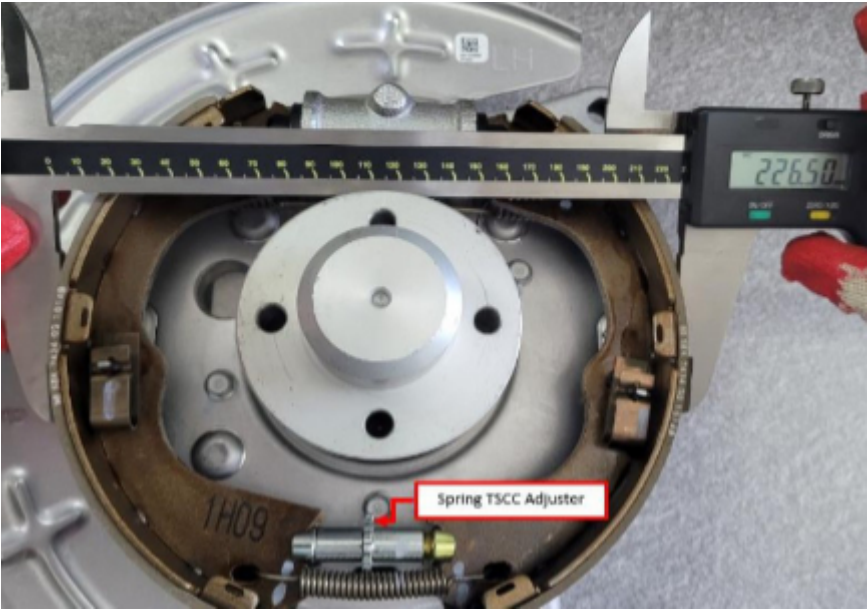

2) After park brake shoe adjustment is at proper range as shown above, perform the following reset procedure to clear codes.

- A) Put the vehicle in Service mode and apply and release the park brake 5 times
- B) Attempt to clear DTCs
- C) Start the vehicle and apply and release the park brake 5 more times
- D) Clear DTCs again and allow vehicle to go to sleep by letting vehicle sit for 10 Minutes.

Note: You may have to perform this procedure a couple times to clear DTCs

Version History

Version	1
Modified	03/22/2024 - Created on.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.