



STAR ONLINE PUBLICATION




Case Number: S2108000272

Release Date: November 2021

Symptom/Vehicle Issue: Check Engine Light Is On. DTC's P0070 And P0073 Are Active For The Ambient Air Temperature Sensor

Discussion: The check engine light may be illuminated. Upon scanning the vehicle you may find multiple DTC's set for the ambient air temperature circuit including P0070 and P0073.

Repair: The Ambient Air Temperature sensor may not have been fully seated. Inspect the D1504A AAT sensor connector behind the left grill. Disconnect and reconnect the connector to confirm it is fully seated.

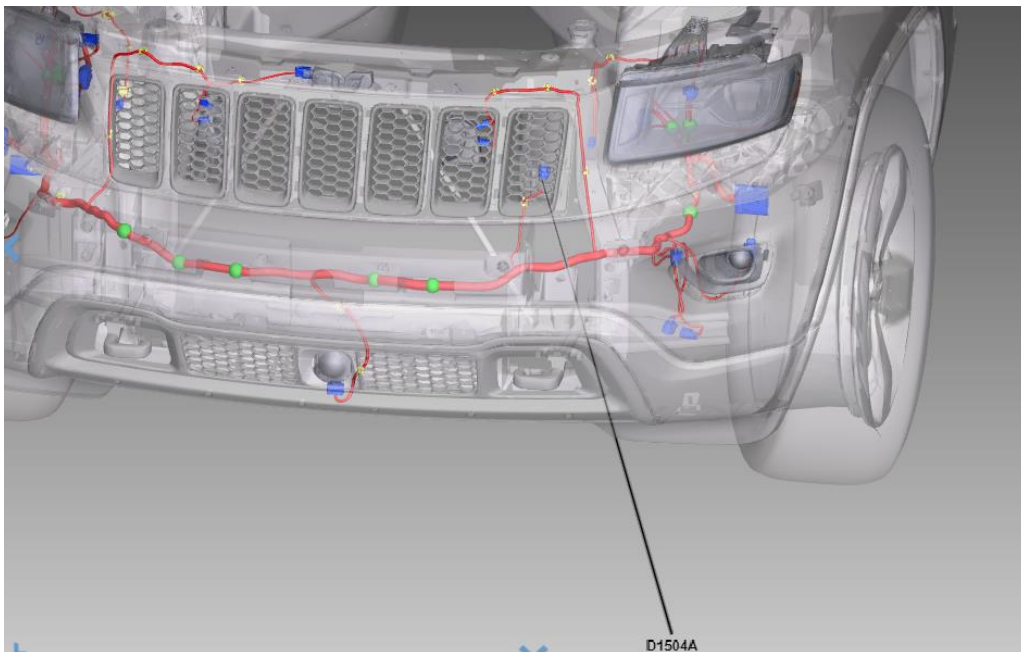

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found



STAR ONLINE PUBLICATION



Verification: Clear the DTC's and verify they no longer return and the CEL is no longer illuminated. Confirm the ambient temperature sensor is reading correctly.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found